

LIMITED DESIGNATED SUBSTANCE SURVEY REPORT (RENOVATION AREAS)



**École élémentaire catholique Sainte Jeanne d'Arc
25 Laurelcrest Street
Brampton, Ontario**

Presented to:
Conseil Scolaire Catholique MonAvenir
110 Drewry Avenue
Toronto, Ontario
M2M 1C8

Attention: Jean Claude Uppiah

May 11, 2018

Maple Project No. 17114

EXECUTIVE SUMMARY

Maple Environmental Inc. ('Maple') was retained by Conseil scolaire catholique MonAvenir ('cscMonAvenir') to perform a survey for Designated Substances as well as polychlorinated biphenyls (PCBs) and mould within the selected areas of École élémentaire catholique Sainte Jeanne d'Arc located at 25 Laurelcrest Street, Brampton, Ontario (the 'Site'). It is our understanding that the building requires a survey to identify possible hazardous building materials that may be disturbed during the renovations of the selected areas.

The survey was limited to: the interior and exterior side of seven (7) specific doors scheduled to either be removed and replaced or refinished. Information pertaining to the subject renovation was provided to Maple by Celluci + Pace Architects on behalf of the cscMonAvenir. The findings of the current survey are summarized below. Please refer to the main body of this report for details on all materials.

Asbestos

Asbestos-containing materials (ACM) identified within the surveyed areas at the time of the assessment are as follows:

- Interior Texture Coat Finishes

It should be noted that due to the presence of solid walls and ceilings (i.e. cinder block walls and above solid ceilings) throughout the survey area, access for viewing within the wall and ceiling cavities was not always possible. Suspect asbestos-containing materials may be present within wall and ceiling cavities that were not identified but are suspected to be present in this report. Caution should be taken when demolishing solid walls and ceilings within the areas being surveyed.

Lead

Based on the Laboratory Analysis Report for lead samples and visual confirmation observation made during the fieldwork:

- Seven (7) bulk samples were collected of the predominant paint colours and the results indicated that the red-brown door paint is considered to be lead-containing, while the remaining painted surfaces are considered to be low level lead (virtually safe).
- One (1) bulk sample was collected of brick mortar and the results indicated that the mortar is not to be considered lead-containing.
- It should be noted that lead may also be present in wiring connectors, electric cable sheathing, solder joints on copper piping, ceramic glazes, lead sheeting, masonry mortar, and as sub-surface layers to the most recent paint layers currently applied, where present at the Site.

Mercury

- Mercury vapour is present in all fluorescent light tubes.

Silica

- Free crystalline silica, present as common construction sand, is present in all concrete and masonry products where present within the surveyed areas.

Mould

- No visible mould growth was observed to be present within the surveyed areas at the time of the assessment.
- It is possible that mould growth is present in concealed areas such as wall or ceiling cavities, pipe chases, etc. or in areas not currently assessed by Maple. The client should notify Maple should any water damage or suspect mould growth be discovered.

PCBs

- The fluorescent lamp fixtures observed contained T8 fluorescent light tubes. T8 fixtures have electronic ballast and are considered not as containing PCBs.

Recommendations

Based on the Laboratory Analytical Results and observations made on Site, Maple provides the following recommendations.

- Removal all asbestos-containing materials that may be disturbed during the planned renovation using the appropriate asbestos abatement procedures as outlined in Section 5.0 of the Report.
- Low Level Lead paints (0.1% or less) are considered virtually safe provided that;
 - airborne lead concentrations are kept below 0.05 mg/m³
 - general dust suppression and worker hygiene procedures are utilized
 - torching or other activities that create fumes are not completed
- Disturbance of paints that are considered Lead-Containing should be completed using Lead abatement procedures as appropriate in accordance with EACO and Ministry of Labour Guidelines as outlined in Section 5.0 of the Report.
- Remove all mercury containing components (including fluorescent light tubes) prior to renovations if the materials are being removed. These components should be removed intact and disposed of appropriately.
- Proper dust suppression techniques and other safety precautions to control possible generation of silica dust from the demolition of concrete and masonry products present in the surveyed area should follow those outlined in the Ministry of Labour Guideline- Silica on Construction Projects, 2004.

Appropriate procedures for asbestos, lead, mercury, and silica must be observed if these materials are likely to be disturbed by scheduled renovations. Please refer to Section 5.0 of the report to review the required procedures.

Consideration should be given to assessing other areas of the building that could be associated with the current project, including travel path, mechanical or electrical ties in the areas outside of the immediate project area, and penetrations through the slab impacting floors below or above.

TABLE OF CONTENTS

1.0	INTRODUCTION	1
2.0	APPLICABLE ONTARIO REGULATIONS	1
2.1	DESIGNATED SUBSTANCES AND OTHER HAZARDOUS MATERIALS	1
2.2	ONTARIO REGULATION 278/05 (ASBESTOS)	2
2.3	ONTARIO REGULATION 347	3
2.4	ONTARIO REGULATION 362.....	3
3.0	SURVEY SCOPE AND METHODOLOGY	3
3.1	ASBESTOS-CONTAINING BUILDING MATERIALS (ACM)	3
3.2	LEAD	5
3.3	MERCURY	5
3.4	OTHER DESIGNATED SUBSTANCES.....	6
3.5	MOULD.....	6
3.6	POLYCHLORINATED BIPHENYLS	6
3.7	LIMITATIONS AND OMISSIONS FROM SCOPE	6
3.8	DRAWINGS	7
3.9	PREVIOUS REPORTS	7
4.0	INVENTORY FINDINGS	7
4.1	ASBESTOS	7
4.2	LEAD	11
4.3	MERCURY	12
4.4	SILICA	12
4.5	ISOCYANATES	12
4.6	VINYL CHLORIDE MONOMER	12
4.7	BENZENE.....	12
4.8	ACRYLONITRILE.....	12
4.9	COKE OVEN EMISSIONS	12
4.10	ARSENIC.....	12
4.11	ETHYLENE OXIDE	12
4.12	MOULD.....	13
4.13	POLYCHLORINATED BIPHENYLS (PCBS).....	13
5.0	RECOMMENDATIONS	13
5.1	ASBESTOS	13
5.2	LEAD	13
5.3	MERCURY	14
5.4	SILICA	14
6.0	LIMITATIONS	14
 <u>APPENDICES</u>		
APPENDIX I	LABORATORY ANALYSIS REPORT - ASBESTOS	
APPENDIX II	LABORATORY ANALYSIS REPORT - LEAD	
APPENDIX III	DRAWINGS	

1.0 INTRODUCTION

Maple Environmental Inc. ('Maple') was retained by Conseil scolaire catholique MonAvenir ('cscMonAvenir') to perform a survey for Designated Substances as well as polychlorinated biphenyls (PCBs) and mould within selected areas of École élémentaire catholique Sainte Jeanne d'Arc located at 25 Laurelcrest Street, Brampton Ontario (the 'Site'). It is Maple's understanding that the building requires a survey to identify possible hazardous building materials that may be disturbed during the renovations of the areas surveyed.

The survey was limited to: the interior and exterior side of seven (7) specific doors scheduled to be either removed and replaced or refinished.

Section 30 of the Ontario Occupational Health and Safety Act requires that the following Designated Substances be included in a Designated Substance Survey:

Asbestos

Lead

Mercury

Silica

Isocyanates

Vinyl Chloride Monomer

Benzene

Acrylonitrile

Coke Oven Emissions

Arsenic

Ethylene Oxide

Additional detailed information with respect to asbestos was collected at the time of the survey to ensure compliance with Ontario Regulation 278/05.

The assessment was performed by Sarah Doyle of Maple on May 2, 2018.

2.0 APPLICABLE ONTARIO REGULATIONS

Applicable Ontario Regulations for each of the materials included in the investigation are briefly described below.

2.1 Designated Substances and Other Hazardous Materials

Section 30 of the Occupational Health and Safety Act requires building owners or their agents (architects, general contractors, etc.) to prepare or have prepared a Designated Substance report for specified potentially hazardous materials possibly present in a facility. The owner must ensure that a prospective constructor has received a Designated Substance report before entering into a binding contract with the contractor. The owner is liable to the contractor for damages and costs arising from unreported materials (of which the owner should reasonably have been aware) and could also be subject to orders and fines from the Ministry of Labour.

In addition to the requirements under the Occupational Health and Safety Act, Section 6 of the Ministry of Labour Regulations for Construction Projects requires the contractor, when submitting the Notice of Project form, report any Designated Substances likely to be used, handled or disturbed during the project.

The disturbance of asbestos materials on construction projects is controlled by Ministry of Labour Regulation R.R.O. 2005/278. The disposal of asbestos waste is controlled by Ministry of Environment Regulation, R.R.O. 1990/347.

There are no specific Ministry of Labour regulations for control of the other Designated Substances on construction projects. However, the Ministry of Labour actively enforces the general duty clause of the Health and Safety Act which protects workers and provides guidance on exposure monitoring, permissible exposure levels, medical monitoring, etc. for all Designated Substances.

Although Regulations exist for many of the Designated Substances, they apply to industry settings using Designated Substances in manufacturing processes, and do not apply to general property management, renovation or maintenance of buildings.

Polychlorinated Biphenyls ("PCBs") and mould were also included in the investigation, which are not specifically named as Designated Substances. No specific regulations are attached to these materials but are generally governed by the due diligence section of the Health and Safety Act for employers to protect their workers.

2.2 Ontario Regulation 278/05 (Asbestos)

Ontario Regulation 278/05 applies to buildings with regards to maintenance, renovations or demolition work where asbestos-containing materials (ACM) is present and may be disturbed. The Regulation requires that a detailed asbestos inventory be performed in all buildings where friable and non-friable asbestos materials are present. The inventory must be available at the work place and must identify the type of asbestos, and location of asbestos on a room-by-room basis. The following report does not necessarily meet the requirements for an asbestos survey under Ontario Regulation 278/05.

In addition, the regulation requires all buildings where asbestos has been used as part of the building to implement an Asbestos Management Program (AMP).

The major requirements of the AMP include:

- Preparation and maintenance of an on-site record of where asbestos material is located;
- Written notification provided to tenants or lessees occupying space where asbestos is present;
- Advise workers of the owner, other staff and outside contractors of the presence and location of ACM;
- Institute and maintain a program for the training and instruction of every worker employed in the building that is likely to work in close proximity to and may disturb asbestos.
- Update the asbestos report (minimum annually)
- Preparation of written asbestos work practices;
- Repair or removal of all damaged asbestos where it may be disturbed; and
- Other record keeping.

2.3 Ontario Regulation 347

Ontario Regulation 347 applies to the transport of waste from the location of generation to a landfill site authorized to receive specific wastes. The regulation also prescribes procedures on how the specific wastes are to be handled at the landfill site.

The major requirements of the building owner and the person(s) removing the waste are to ensure that:

- The waste is appropriately packaged and labelled;
- The transport vehicle is appropriately placard; and
- The waste is to be transported as directly as possible to the landfill site once it leaves the site.

Some wastes require the owner to register a Generator (of waste) number and many wastes require classification that can restrict or even prohibit their disposal in landfill.

It is important to note that the building owner can be held responsible for the waste until the waste disposal site accepts it.

2.4 Ontario Regulation 362

Ontario Regulation 362, made under the Ontario Environmental Protection Act applies to the waste management and transport of PCB waste from the location of generation to a landfill site authorized to receive specific wastes. The regulation also prescribes procedures on how the specific wastes are to be handled at the landfill site.

3.0 SURVEY SCOPE AND METHODOLOGY

The survey was limited to: the interior and exterior side of seven (7) specific doors scheduled to be either removed and replaced or refinished. The methodology included the assessment for hazardous materials and how the assessment was performed is outlined below.

In order to determine the location of materials included in the assessment, the project technologist entered the room where practical (i.e. where access was possible without the demolition of walls, roof or ceilings or destruction of flooring). Representative views were made above accessible suspended ceiling systems. Cavities within solid ceiling and wall systems were accessed via existing access panels only. The inventory did not include demolition of building systems or finishes to check on possible hidden conditions.

3.1 Asbestos-Containing Building Materials (ACM)

The scope of the survey included all friable asbestos products and all major non-friable asbestos materials. The term friable is applied to a material that can be readily reduced to dust or powder by hand or moderate pressure. Asbestos materials that are friable have a much greater potential to release airborne asbestos fibres when disturbed.

Typical friable asbestos materials include: sprayed fireproofing or thermal insulation, textured (stippled) plaster, and thermal mechanical insulation. Typical non-friable materials include: asbestos cement (transite) products, vinyl floor tiles, asbestos textiles and gaskets. Additional materials such as ceiling tiles, drywall joint compounds and vinyl sheet flooring are classified as non-friable, but because of their ability to release dust when disturbed are considered as "potentially friable" for the purpose of this report.

Bulk samples of materials suspected to contain asbestos were collected for analysis during the survey. Specifically, a small volume of material was removed either from a damaged section of suspect material or taken from intact material. In these latter cases, the material from which the sample was collected was sealed with tape to temporarily prevent fibre release. Samples were placed in plastic bags and sealed until receipt by an independent laboratory. To ensure quality results, the independent laboratory chosen successfully participates in an "Asbestos Proficiency Analytical Testing Program". As such, these independent laboratories are responsible for their findings.

Bulk samples were collected in accordance with regulatory sampling requirements and with sufficient frequency to obtain a general pattern of asbestos use within the building. Due to building renovations or modifications that may have occurred in the past, the consistency of the application of asbestos materials may not be uniform throughout the entire Site. It is important to note that without sampling each individual wall, pipe section, ceiling tile etc. it is not possible to identify the asbestos content of every material present in the selected areas. For this reason, visually similar materials are considered to be homogenous with those already sampled elsewhere in the building without additional analysis.

O. Reg. 278/05 prescribes that a minimum number of samples be collected of materials suspected to contain asbestos. These minimum sampling requirements are summarized in Table 1, below.

Table 1 - Suspect ACM Bulk Sampling Requirements

Type of Material	Quantity of Material Present	Minimum # of Bulk Samples Required
Surfacing Materials (i.e. sprayed fireproofing, drywall joint compound, texture coat, and plaster)	Up to 90 sq. m. (1000 sq. ft.)	3
	From 90 sq. m. (1000 sq. ft.) to 450 sq. m. (5000 sq. ft.)	5
	Greater than 450 sq. m. (5000 sq. ft.)	7
All other potential ACM	Any	3

Excluding surfacing materials, the laboratory was instructed to cease analysis within Sample Groups of homogenous materials when one of the samples in the group is found to contain asbestos. For example, if three samples of a type of vinyl floor tile are collected (as required by O. Reg. 278/05) and submitted for analysis and the first sample is positively identified as containing asbestos, the balance of the sample group is not analysed.

EMC Scientific Inc. ('EMC'), an independent laboratory, was selected to analyse the collected bulk suspect asbestos samples. EMC successfully participates in an "Asbestos

Proficiency Analytical Testing Program" and as such, is responsible for its findings. EMC followed the Code of Practice for the identification of asbestos in bulk material, as detailed in O. Reg. 278/05. Bulk samples were analysed using the Polarized Light Microscopy ("PLM") Technique with Dispersion Staining. The identification of asbestos fibre in bulk material is based on a collective set of parameters dependent on the unique shape and crystallographic properties of each fibre as viewed through the microscope. This method is useful for the qualitative identification of asbestos and the semi-quantitative determination of asbestos content in bulk materials expressed as a percent of projected area. The method identifies types of asbestos and also measures percent of asbestos as perceived by the analyst in comparison to standard area projections or trained experience.

The recommendations made as part of this report with respect to asbestos have taken into consideration: the condition and accessibility of the material, vibration, air movement, and general activities likely to occur within the vicinity of the ACM.

In each area or room inventoried, the technician recorded the quantity, condition (GOOD, FAIR, or POOR) of each suspect asbestos-containing material.

The definitions for condition and accessibility of the asbestos-containing items are as follows:

GOOD	Material is intact with no visible signs of damage.
FAIR	Material is visibly damaged but can be repaired.
POOR	Material is damaged beyond repair and likely needs to be removed.

Where ACM is found to be in GOOD condition and not likely to deteriorate or fall, the general recommendation would be to re-evaluate the condition of the material on an annual basis (required by O. Reg. 278/05). This recommendation can be subject to change if the material is located in a manner that persons untrained in asbestos awareness could physically damage it.

Where ACM is found to be damaged (i.e. FAIR or POOR condition), a recommendation to have the material cleaned-up, repaired, removed, enclosed, or encapsulated is offered. The recommendation will also indicate which asbestos procedure should be used to perform the remedial work (i.e. Type 1, Type 2, Type 3, or Glove Bag Removal Methods).

3.2 Lead

The investigation included the collection and analysis of all major paint colour applications for the presence of lead in the paint. Other materials that possibly contain lead were identified by known historic use, where relevant. The lead in paint samples were analysed by EMSL Canada ('EMSL'), using atomic absorption spectrophotometry. EMSL is AIHA (American Industrial Hygiene Association) and NIOSH (National Institute of Occupational Safety and Health) accredited for this type of analysis. The Laboratory Analysis Report for lead in paint samples is included with this Report as Appendix II.

3.3 Mercury

The assessment included a visual identification of fluorescent light tubes, switches, electrical controls, heating system thermostats, thermometers, and other components historically known to contain mercury.

3.4 Other Designated Substances

Other materials listed in Section 1.0 of this Report were identified on a visual basis where present, as part of the current assessment. It should be noted that no manufacturing or heavy industrial activities are known by Maple to occur at the Site. Therefore, Designated Substances associated with these activities (i.e. those other than Asbestos, Lead, Mercury, and Silica) would not be expected to be present in the selected areas.

3.5 Mould

The assessment for mould was conducted in accordance with standard industry practice as set out in the Canadian Construction Association (CCA) "Mould Guidelines for the Canadian Construction Industry" for a visual assessment. Although there are no regulatory requirements in Ontario for such an assessment, the CCA Guidelines, and similar guidelines from other agencies have been accepted as the industry standard by most experts, consultants, the Ontario Ministry of Labour, and the Canadian Construction Association.

All guidelines and protocols for mould investigations indicate that investigations should be performed largely on a visual basis with limited collection of bulk and/or air samples. The Ontario Ministry of Labour has consistently enforced the removal of all mould from buildings regardless of mould genus or species, and therefore bulk samples or air samples for confirmation of mould are not typically collected for investigative purposes where mould is visible.

3.6 Polychlorinated Biphenyls

Manufacturers labels/codes collected from fluorescent lamp ballasts suspected of containing Polychlorinated Biphenyls ("PCBs") are compared with Environment Canada's document titled "Identification of Lamp Ballasts Containing PCBs", which identifies PCB-containing ballasts.

3.7 Limitations and Omissions from Scope

Due to the nature of building construction some limitations exist as to the possible thoroughness of any building materials inventory. The field observations, measurements, and analysis are considered sufficient in detail and scope to form a reasonable basis for the findings presented in this report. Maple warrants that the findings and conclusions contained herein have been made in accordance with generally accepted evaluation methods in the industry and applicable regulations at the time of the performance of the inventory.

It is possible that conditions may exist which could not be reasonably identified within the scope of the inventory or which were not apparent during the Site investigation. Maple believes that the information collected during the investigation concerning the property is reliable. No other warranties are implied or expressed.

During a standard ACM inventory performed for the purposes of regulatory compliance, it is industry practice to exclude certain suspect asbestos-containing materials from sampling. These materials are often excluded from sampling due to the risk of compromising the health and safety of the technician, other building occupants, or the integrity of the systems with which these materials are associated. Examples of such materials include; elevator brakes, roofing felts and mastics, high voltage wiring, mechanical packing and gaskets, underground services or piping,

fire-doors, and levelling compound. Where observed, these materials were presumed to be ACM.

3.8 Drawings

Drawings included in Appendix III will indicate the locations of any major applications of an asbestos-containing material with the exception of mechanical insulations, drywall, plaster finishes and transite (which cannot be accurately depicted on drawings). The information depicted on the drawings is not to scale and is only meant to provide a general representation of the locations of asbestos-containing materials.

3.9 Previous Reports

Where possible, Maple utilized the observations and representative bulk sampling results from previous Survey Reports that were made available at the time of the survey. Maple utilized sampling data from the following source:

- October 2017 – Maple Environmental Inc. Project 16302 – Reassessment of Hazardous Building Materials Survey Report.

4.0 INVENTORY FINDINGS

The findings of the survey are presented separately below for each of the eleven Designated Substances as well as microbial growth (mould), and polychlorinated biphenyls. Asbestos is further detailed by typical applications of asbestos.

4.1 Asbestos

The following is a brief discussion of the extent to which ACM was identified in the surveyed area. The discussion is organized under the headings of materials that are generally suspected of containing asbestos. The sample numbers refer to the laboratory analysis report presented as Appendix I and summarised in Table 2 below. Twenty-one (21) bulk samples were collected for the determination of asbestos content and submitted to the lab to be analysed.

Table 2 - Summary of Analysis of Asbestos Bulk Samples

Sample No.	Room Name	Sample Description	Result
S01A	Door 2, Interior	Dark Brown Door Caulking	ND
S01B	Door 3, Interior	Dark Brown Door Caulking	ND
S01C	Door 2, Interior	Dark Brown Door Caulking	ND
S02A	Door 2, Exterior	Grey Wall Caulking	ND
S02B	Door 4, Exterior	Grey Wall Caulking	ND
S02C	Door 1, Exterior	Grey Wall Caulking	ND
S03A	Door 3, Exterior	Texture Coat Soffit	ND
S03B	Door 3, Exterior	Texture Coat Soffit	ND
S03C	Door 1, Exterior	Texture Coat Soffit	ND

Sample No.	Room Name	Sample Description	Result
S04A	Door 4, Interior	White Door Caulking	ND
S04B	Door 5, Interior	White Door Caulking	ND
S04C	Door 1, Interior	White Door Caulking	ND
S05A	Port-a-Pak Exterior	Cement Panel	ND
S05B	Port-a-Pak Exterior	Cement Panel	ND
S05C	Port-a-Pak Exterior	Cement Panel	ND
S06A	Door 4, Exterior	Large Grey Caulking	ND
S06B	Door 4, Exterior	Large Grey Caulking	ND
S06C	Door 4, Exterior	Large Grey Caulking	ND
S07A	Door 6, Interior	Drywall Joint Compound	ND
S07B	Door 7, Interior	Drywall Joint Compound	ND
S07C	Door 7, Interior	Drywall Joint Compound	ND

ND – None Detected

Asbestos-containing materials (ACM) are present in the form of interior texture coat ceiling finishes. Details for all confirmed and suspect asbestos-containing materials are presented below under the headings of the most typical asbestos applications in buildings.

It should be noted that due to the presence of solid walls and ceilings (i.e. cinder block walls and above solid ceilings) throughout the survey area, access for viewing within the wall and ceiling cavities was not always possible. Suspect asbestos-containing materials may be present within wall and ceiling cavities that were not identified but are suspected to be present in this report. Caution should be taken when demolishing solid walls and ceilings within the areas being surveyed.

4.1.1 Sprayed Fireproofing

No sprayed fireproofing was observed within the surveyed areas.

4.1.2 Thermal Mechanical Insulation (Friable)

Piping Systems:

Pipe systems within the surveyed areas were observed to be either not insulated or were insulated with fibreglass, which is not suspected to contain asbestos.

Duct Systems

Duct systems within the surveyed areas were observed to be not insulated.

Mechanical Equipment

Radiators within the surveyed areas were observed to be externally un-insulated.

4.1.3 Texture Finish (Friable)

Asbestos and non-asbestos textured finishes were identified within the surveyed areas at the time of the assessment.

Two (2) distinct types of texture finish were observed within the surveyed areas. A brief description of each type is outlined below.

- **Interior Texture Coat**

Texture coat finishes were observed to be present as interior ceiling finishes within various areas. Interior texture coat is applied to drywall.

No bulk samples of interior texture coat ceiling finishes were collected during the current assessment as the material was previously sampled by Maple and was found to contain **Chrysotile asbestos**.

- **Exterior Texture Coat**

Texture coat finishes were observed to be present as exterior soffit finishes within various areas. Exterior texture coat is applied to drywall.

Three (3) representative samples (Sample Set S03A-C) of exterior texture coat finishes were collected and analysed for determination of asbestos content. Analysis of Sample Set S03 found that the samples do not contain asbestos.

4.1.4 Acoustic Ceiling Tiles (Potentially Friable)

No asbestos-containing acoustic ceiling tile systems were observed within the surveyed areas.

No bulk samples of acoustic ceiling tile systems were collected during the current assessment as the tiles were previously sampled by Maple and were found not to contain asbestos.

4.1.5 Vinyl Sheet Flooring (Potentially Friable)

No asbestos-containing vinyl sheet flooring finishes were observed within the surveyed areas.

It should be noted that asbestos-containing vinyl sheet flooring systems are present in other areas of the building that will not be impacted by the proposed renovations.

4.1.6 Vinyl Floor Tile (Non-Friable)

No asbestos-containing vinyl floor tile systems were observed within the surveyed areas.

No bulk samples of vinyl floor tile systems were collected during the current assessment as the tiles were noted to be recently installed, and therefore not suspected to contain asbestos.

It should be noted that asbestos-containing vinyl floor tiles are present in other areas of the building that will not be impacted by the proposed renovations.

4.1.7 Asbestos Cement Products "Transite" (Non-Friable)

No asbestos-containing transite cement products were identified within the surveyed areas.

Cement panels were observed on the exterior walls of the port-a-pak.

Three (3) representative Samples (Sample Set S05A-C) of cement panels were collected and analysed for determination of asbestos content. Analysis of Sample Set S05 found that the samples do not contain asbestos.

4.1.8 Drywall Joint Compound (DJC) (Potentially Friable)

No asbestos-containing drywall joint compound were identified within the surveyed areas.

Drywall with joint compound applied was observed as a concealed second ceiling within the interior of the port-a-pak.

Three (3) representative samples (Sample Set S07A-C) of drywall joint compound were collected and analysed for determination of asbestos content. Analysis of Sample Set S07 found that the samples do not contain asbestos.

4.1.9 Plaster (Potentially Friable)

No plaster finishes were observed within the surveyed area.

4.1.10 Vermiculite (Friable)

No vermiculite insulation was observed to be present within the surveyed area at the time of the assessment. It should be noted that loose fill vermiculite insulation can often be present within voids of masonry and possibly some pre-manufactured surveyed area components that would not be identified during the course of this assessment.

4.1.11 Other

- Dark Brown Interior Door Caulking

Dark brown caulking was observed to be applied to interior door frames in various locations.

Three (3) representative samples (Sample Set S01A-C) of dark brown interior door caulking were collected and analysed for determination of asbestos content. Analysis of Sample Set S01 found that the samples do not contain asbestos.

- Grey Exterior Wall and Door Caulking

Grey caulking was observed to be applied to exterior walls and door frames in various locations.

Three (3) representative samples (Sample Set S02A-C) of grey exterior wall caulking were collected and analysed for determination of asbestos content. Analysis of Sample Set S02 found that the samples do not contain asbestos.

- White Interior Door Caulking
White caulking was observed to be applied to interior door frames in various locations.
Three (3) representative samples (Sample Set S04A-C) of white interior door caulking were collected and analysed for determination of asbestos content. Analysis of Sample Set S04 found that the samples do not contain asbestos.
- Large Grey Exterior Wall Caulking
Large grey exterior caulking was observed to be applied to exterior walls and seams between the walls and the ground.
Three (3) representative samples (Sample Set S06A-C) of large grey exterior caulking were collected and analysed for determination of asbestos content. Analysis of Sample Set S06 found that the samples do not contain asbestos.

4.2 Lead

Seven (7) bulk paint samples and one (1) bulk brick mortar sample were collected for determination of lead content and submitted to EMSL for analysis during the assessment. The sample number refers to the Certificate of Analysis Report presented as Appendix II and summarised in Table 3 below.

Table 3 - Summary of Analysis of Lead-in-Paint Samples

Sample No.	Locations	Sample Description	Result
Pb01	Interior & Exterior Doors	Red-Brown Paint	0.18%
Pb02	Interior Trim	Brown Paint	<0.0088%
Pb03	Exterior Trim and Doors	Dark Brown Paint	0.013%
Pb04	Interior Walls	Off-White Paint	<0.0085%
Pb05	Interior Walls	Light Brown Paint	<0.0082%
Pb06	Port-a-Pak Doors	Grey Paint	<0.0086%
Pb07	Port-a-Pak Trim	Dark Grey Paint	<0.0082%
Pb08	Exterior	Brick Mortar	<40 mg/Kg

No regulations currently exist in Ontario defining the lower limit of lead-containing material. The Ontario Ministry of Labour (MOL) has issued a guideline for lead abatement, entitled Guideline – Lead on Construction Projects (2004) which is considered enforceable. The Guideline does not specify what constitutes a material as “lead-containing”. Instead, it outlines procedures based on the concentration of airborne lead encountered during removal, as well as provides procedures and/or specific operations for lead-containing material removal. However, the Environmental Abatement Council of Ontario (EACO) Lead Guideline for Construction, Renovation, Maintenance or Repair document classifies paint as either Low-Level, Lead-Containing, or Lead-Based as follows:

Concentration of Lead (%)	Definition
0.1 or less	Low Level Lead (Virtually Safe)
Greater than 0.1 but less than 0.5	Lead-Containing
0.5 or greater	Lead-Based

Brick mortar lead concentrations below 1000 mg/Kg are considered to be Low Level Lead (virtually safe).

Based on these criteria and the results of the sample analysis, red-brown door paint is considered to be lead-containing. All other paints sampled and brick mortar are considered to be low level lead (virtually safe).

4.3 Mercury

Mercury vapour is present in all fluorescent light tubes.

4.4 Silica

Free crystalline silica, present as common construction sand, is present in all concrete and masonry products where present in the surveyed areas.

4.5 Isocyanates

Free isocyanate compounds would not be expected to be found in a non-manufacturing facility.

4.6 Vinyl Chloride Monomer

Vinyl chloride monomer would not be expected to be found in a non-manufacturing facility.

4.7 Benzene

Benzene would not be expected to be found in a non-manufacturing facility.

4.8 Acrylonitrile

Acrylonitrile would not be expected to be found in a non-manufacturing facility.

4.9 Coke Oven Emissions

Coke oven emissions would not be expected to be found in a non-manufacturing facility.

4.10 Arsenic

Arsenic would not be expected to be found in a non-manufacturing facility.

4.11 Ethylene Oxide

Ethylene oxide would not be expected to be found in a non-manufacturing facility.

4.12 Mould

No mould growth was observed within the surveyed areas.

It is possible that mould growth is present in concealed areas such as wall or ceiling cavities, pipe chases, etc. or in areas not currently assessed by Maple. The client should notify Maple should any water damage or suspect mould growth be discovered.

4.13 Polychlorinated Biphenyls (PCBs)

The fluorescent lamp fixtures observed contained T8 fluorescent light tubes. T8 fixtures have electronic ballast and are considered not as containing PCBs.

5.0 RECOMMENDATIONS

5.1 Asbestos

Asbestos materials within the known project areas are limited to interior texture coat ceiling finishes.

Removal or disturbance of ACM texture coat less than 1m² requires the use of Type 2 Asbestos procedures; greater than 1m² Type 3 Asbestos procedures apply.

It is important to note that due to the presence of solid wall and ceiling systems, the assessment was not able to confirm or deny the presence of ACM within wall and ceiling cavities. The presence of concealed ACM should be assumed. It is possible that ACM is present that was not identified in this report.

5.2 Lead

Low Level Lead paints (0.1% or less) are considered virtually safe provided that;

- airborne lead concentrations are kept below 0.05 mg/m³
- general dust suppression and worker hygiene procedures are utilized
- torching or other activities that create fumes are not completed

Red-brown door paint is considered to be lead-containing. Follow appropriate procedures if disturbed or removed.

Disturbance of paints that are considered Lead-Containing should be completed using Lead abatement procedures as appropriate in accordance with EACO and Ministry of Labour Guidelines and are generally as follows;

- Class 1 Lead abatement procedures (removing paint by means of chemical stripper or heat gun, removal of lead sheeting),
- Class 2A Lead abatement procedures (removal of lead paint using power tools equipped with HEPA vacuum attachment, removal by scraping or sanding using non-powered hand tools, or manual demolition of plaster finishes)
- Class 3A Lead abatement procedures (removal using power tools, welding or torching,
- Class 3B Lead abatement procedures (for abrasive blasting).

5.3 Mercury

Mercury vapour is present in all fluorescent light tubes. All fluorescent light tubes should be handled and disposed of appropriately.

5.4 Silica

Proper dust suppression techniques and other safety precautions to control possible generation of silica dust from the demolition of concrete and masonry products present in the building should follow those outlined in the Ministry of Labour Guideline- Silica on Construction Projects, 2004.

6.0 LIMITATIONS

Due to the nature of building construction some limitations exist as to the possible thoroughness of the subject investigation. The field observations are considered sufficient in detail and scope to form a reasonable basis for the findings presented in this report. Maple warrants that the findings and conclusions contained herein have been made in accordance with generally accepted evaluation methods in the industry and applicable regulations at the time of the performance of the assessment.

It is possible that conditions may exist which could not be reasonably identified within the scope of the investigation or which were not apparent during the site investigation. Maple believes that the information collected during the investigation period concerning the property is reliable. No other warranties are implied or expressed.

Information provided by Maple is intended for Client use ONLY. Any use by a third party, of reports or documents authored by Maple, or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Maple accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted.

The liability of Maple or its staff will be limited to the lesser of the fees paid or actual damages incurred by the Client. Maple will not be responsible for any consequential or indirect damages. Maple will only be liable for damages resulting from negligence of Maple; all claims by the Client shall be deemed relinquished if not made within two years after last date of services provided.

Please contact Maple Environmental Inc. at (905) 257-4408 for inquiries regarding this project.

MAPLE ENVIRONMENTAL INC.

Environment, Health and Safety Consultants

Prepared By:



**Sarah Doyle
Project Technologist**

Reviewed By:



**Jason De Sousa
Project Manager**

APPENDIX I


LABORATORY ANALYSIS REPORT - ASBESTOS

To:

Sarah Doyle
 Maple Environmental Inc.
 482 South Service Road East, Suite 116
 Oakville, Ontario
 L6J 2X6

EMC LAB REPORT NUMBER: A39404
Job/Project Name: Sainte Jeanne d'Arc
Analysis Method: Polarized Light Microscopy – EPA 600
Date Received: May 3/18 **Date Analyzed:** May 7/18
Analyst: Jon Delos Santos, *Laboratory Supervisor*
Reviewed By: Fajun Chen, Ph.D., *Laboratory Director*

Job No: 17114
Number of Samples: 21
Date Reported: May 8/18

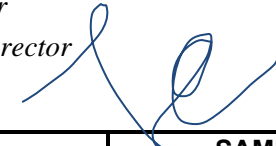

Client's Sample ID	Lab Sample No.	Description/Location	Sample Appearance	SAMPLE COMPONENTS (%)		
				Asbestos Fibres	Non-asbestos Fibres	Non-fibrous Material
S01A	A39404-1	Dark brown interior door caulking, door 2	Brown, caulking	ND		100
S01B	A39404-2	Dark brown interior door caulking, door 3	Brown, caulking	ND		100
S01C	A39404-3	Dark brown interior door caulking, door 2	Brown, caulking	ND		100
S02A	A39404-4	Grey exterior wall caulking, door 2	Grey, caulking	ND		100
S02B	A39404-5	Grey exterior wall caulking, door 4	Grey, caulking	ND		100
S02C	A39404-6	Grey exterior wall caulking, door 1	Grey, caulking	ND		100
S03A	A39404-7	Texture coat soffit, door 3	White, texture coat	ND		100
S03B	A39404-8	Texture coat soffit, door 3	White, texture coat	ND		100
S03C	A39404-9	Texture coat soffit, door 1	White, texture coat	ND		100
S04A	A39404-10	White interior door caulking, door 4	White, caulking	ND		100
S04B	A39404-11	White interior door caulking, door 5	White, caulking	ND		100
S04C	A39404-12	White interior door caulking, door 1	White, caulking	ND		100
S05A	A39404-13	Transite panels, port-a-pak exterior	Grey, cementitious material with fibers	ND	10	90

EMC LAB REPORT NUMBER: A39404

Client's Job/Project No.: 17114

Analyst: Jon Delos Santos, *Laboratory Supervisor*

Client's Sample ID	Lab Sample No.	Description/Location	Sample Appearance	SAMPLE COMPONENTS (%)		
				Asbestos Fibres	Non-asbestos Fibres	Non-fibrous Material
S05B	A39404-14	Transite panels, port-a-pak exterior	Grey, cementitious material with fibers	ND	10	90
S05C	A39404-15	Transite panels, port-a-pak exterior	Grey, cementitious material with fibers	ND	10	90
S06A	A39404-16	Large grey caulking, door 4	Grey, caulking	ND		100
S06B	A39404-17	Large grey caulking, door 4	Grey, caulking	ND		100
S06C	A39404-18	Large grey caulking, door 4	Grey, caulking	ND		100
S07A	A39404-19	Drywall joint compound, port-a-pak door 6	White, joint compound	ND		100
S07B	A39404-20	Drywall joint compound, port-a-pak door 7	White, joint compound	ND		100
S07C	A39404-21	Drywall joint compound, port-a-pak door 7	White, joint compound	ND		100

Note:

1. Bulk samples are analyzed using Polarized Light Microscopy (PLM) and dispersion staining techniques. The analytical procedures are in accordance with EPA 600/R-93/116 method.
2. The results are only related to the samples analyzed. **ND** = None Detected (no asbestos fibres were observed), **NA** = Not Analyzed (analysis stopped due to a previous positive result).
3. This report may not be reproduced, except in full without the written approval of EMC Scientific Inc. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government.
4. The Ontario Regulatory Threshold for asbestos is 0.5%. The limit of quantification (LOQ) is 0.5%.

APPENDIX II

LABORATORY ANALYSIS REPORT – LEAD

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or	551805113
CustomerID:	55MAPL78
CustomerPO:	17114
ProjectID:	

Attn: **Sarah Doyle**
Maple Environmental, Inc.
482 South Service Road East
Suite 116
Oakville, ON L6J 2X6

Phone: (905) 257-4408
 Fax: (905) 257-8865
 Received: 05/03/18 3:55 PM
 Collected: 5/2/2018

Project: 17114: Sainte Jeanne d'Arc

Test Report: Lead in Paint Chips by Flame AAS (SW 846 3050B/7000B)*

<i>Client Sample Description</i>	<i>Lab ID</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>Lead Concentration</i>
Pb-01 Site: Red-brown Paint - Doors	551805113-0001	5/2/2018	5/7/2018	0.2381 g	0.18 % wt
Pb-02 Site: Brown Paint - trim	551805113-0002	5/2/2018	5/7/2018	0.2278 g	<0.0088 % wt
Pb-03 Site: Dark Brown Paint - doors/trim	551805113-0003	5/2/2018	5/7/2018	0.2405 g	0.013 % wt
Pb-04 Site: Off-white paint, walls	551805113-0004	5/2/2018	5/7/2018	0.2357 g	<0.0085 % wt
Pb-05 Site: Light Brown Paint - walls/trim	551805113-0005	5/2/2018	5/7/2018	0.2448 g	<0.0082 % wt
Pb-06 Site: Grey paint - doors	551805113-0006	5/2/2018	5/7/2018	0.2327 g	<0.0086 % wt
Pb-07 Site: Dark Grey paint - trim	551805113-0007	5/2/2018	5/7/2018	0.2443 g	<0.0082 % wt

Rowena Fanto, Lead Supervisor
 or other approved signatory

*Analysis following Lead in Paint by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 0.010 % wt based on the minimum sample weight per our SOP. Unless noted, results in this report are not blank corrected. This report relates only to the samples reported above and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities. Samples received in good condition unless otherwise noted. "<" (less than) result signifies that the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. The QC data associated with the sample results included in this report meet the recovery and precision requirements unless specifically indicated otherwise. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON A2LA Accredited Environmental Testing Cert #2845.08

Initial report from 05/10/2018 10:21:40

**EMSL Canada Inc.**

2756 Slough Street, Mississauga, ON L4T 1G3

Phone/Fax: (289) 997-4602 / (289) 997-4607

<http://www.EMSL.com>torontolab@emsl.com

EMSL Canada Or	551805113
CustomerID:	55MAPL78
CustomerPO:	17114
ProjectID:	

Attn: **Sarah Doyle**
Maple Environmental, Inc.
482 South Service Road East
Suite 116
Oakville, ON L6J 2X6

Phone: (905) 257-4408
 Fax: (905) 257-8865
 Received: 05/03/18 3:55 PM
 Collected: 5/2/2018

Project: 17114: Sainte Jeanne d'Arc

Test Report: Lead in Soils by Flame AAS (SW 846 3050B/7000B)*

<i>Client Sample Description</i>	<i>Lab ID</i>	<i>Collected</i>	<i>Analyzed</i>	<i>Weight</i>	<i>Lead Concentration</i>
Pb-08	551805113-0008	5/2/2018	5/9/2018	0.5038 g	<40 mg/Kg
Site: Brick Mortar					

Rowena Fanto, Lead Supervisor
 or other approved signatory



*Analysis following Lead in Soil/Solids by EMSL SOP/Determination of Environmental Lead by FLAA. Reporting limit is 40 mg/kg based on the minimum sample weight per our SOP. Unless noted, results in this report are not blank corrected. This report relates only to the samples reported above and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities. Samples received in good condition unless otherwise noted. Results reported based on dry weight. "<" (less than) result signifies that the analyte was not detected at or above the reporting limit. Measurement of uncertainty is available upon request. The QC data associated with the sample results included in this report meet the recovery and precision requirements unless specifically indicated otherwise. Definitions of modifications are available upon request.

Samples analyzed by EMSL Canada Inc. Mississauga, ON A2LA Accredited Environmental Testing Cert #2845.08

Initial report from 05/10/2018 10:21:40

APPENDIX III
DRAWINGS

drawn by: S. Doyle
 May 2018
 casMonAvenir, Sainte Jeanne d'Arc, 25 Laurelcrest Street, Brampton, Ontario, Ground Floor

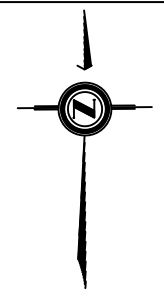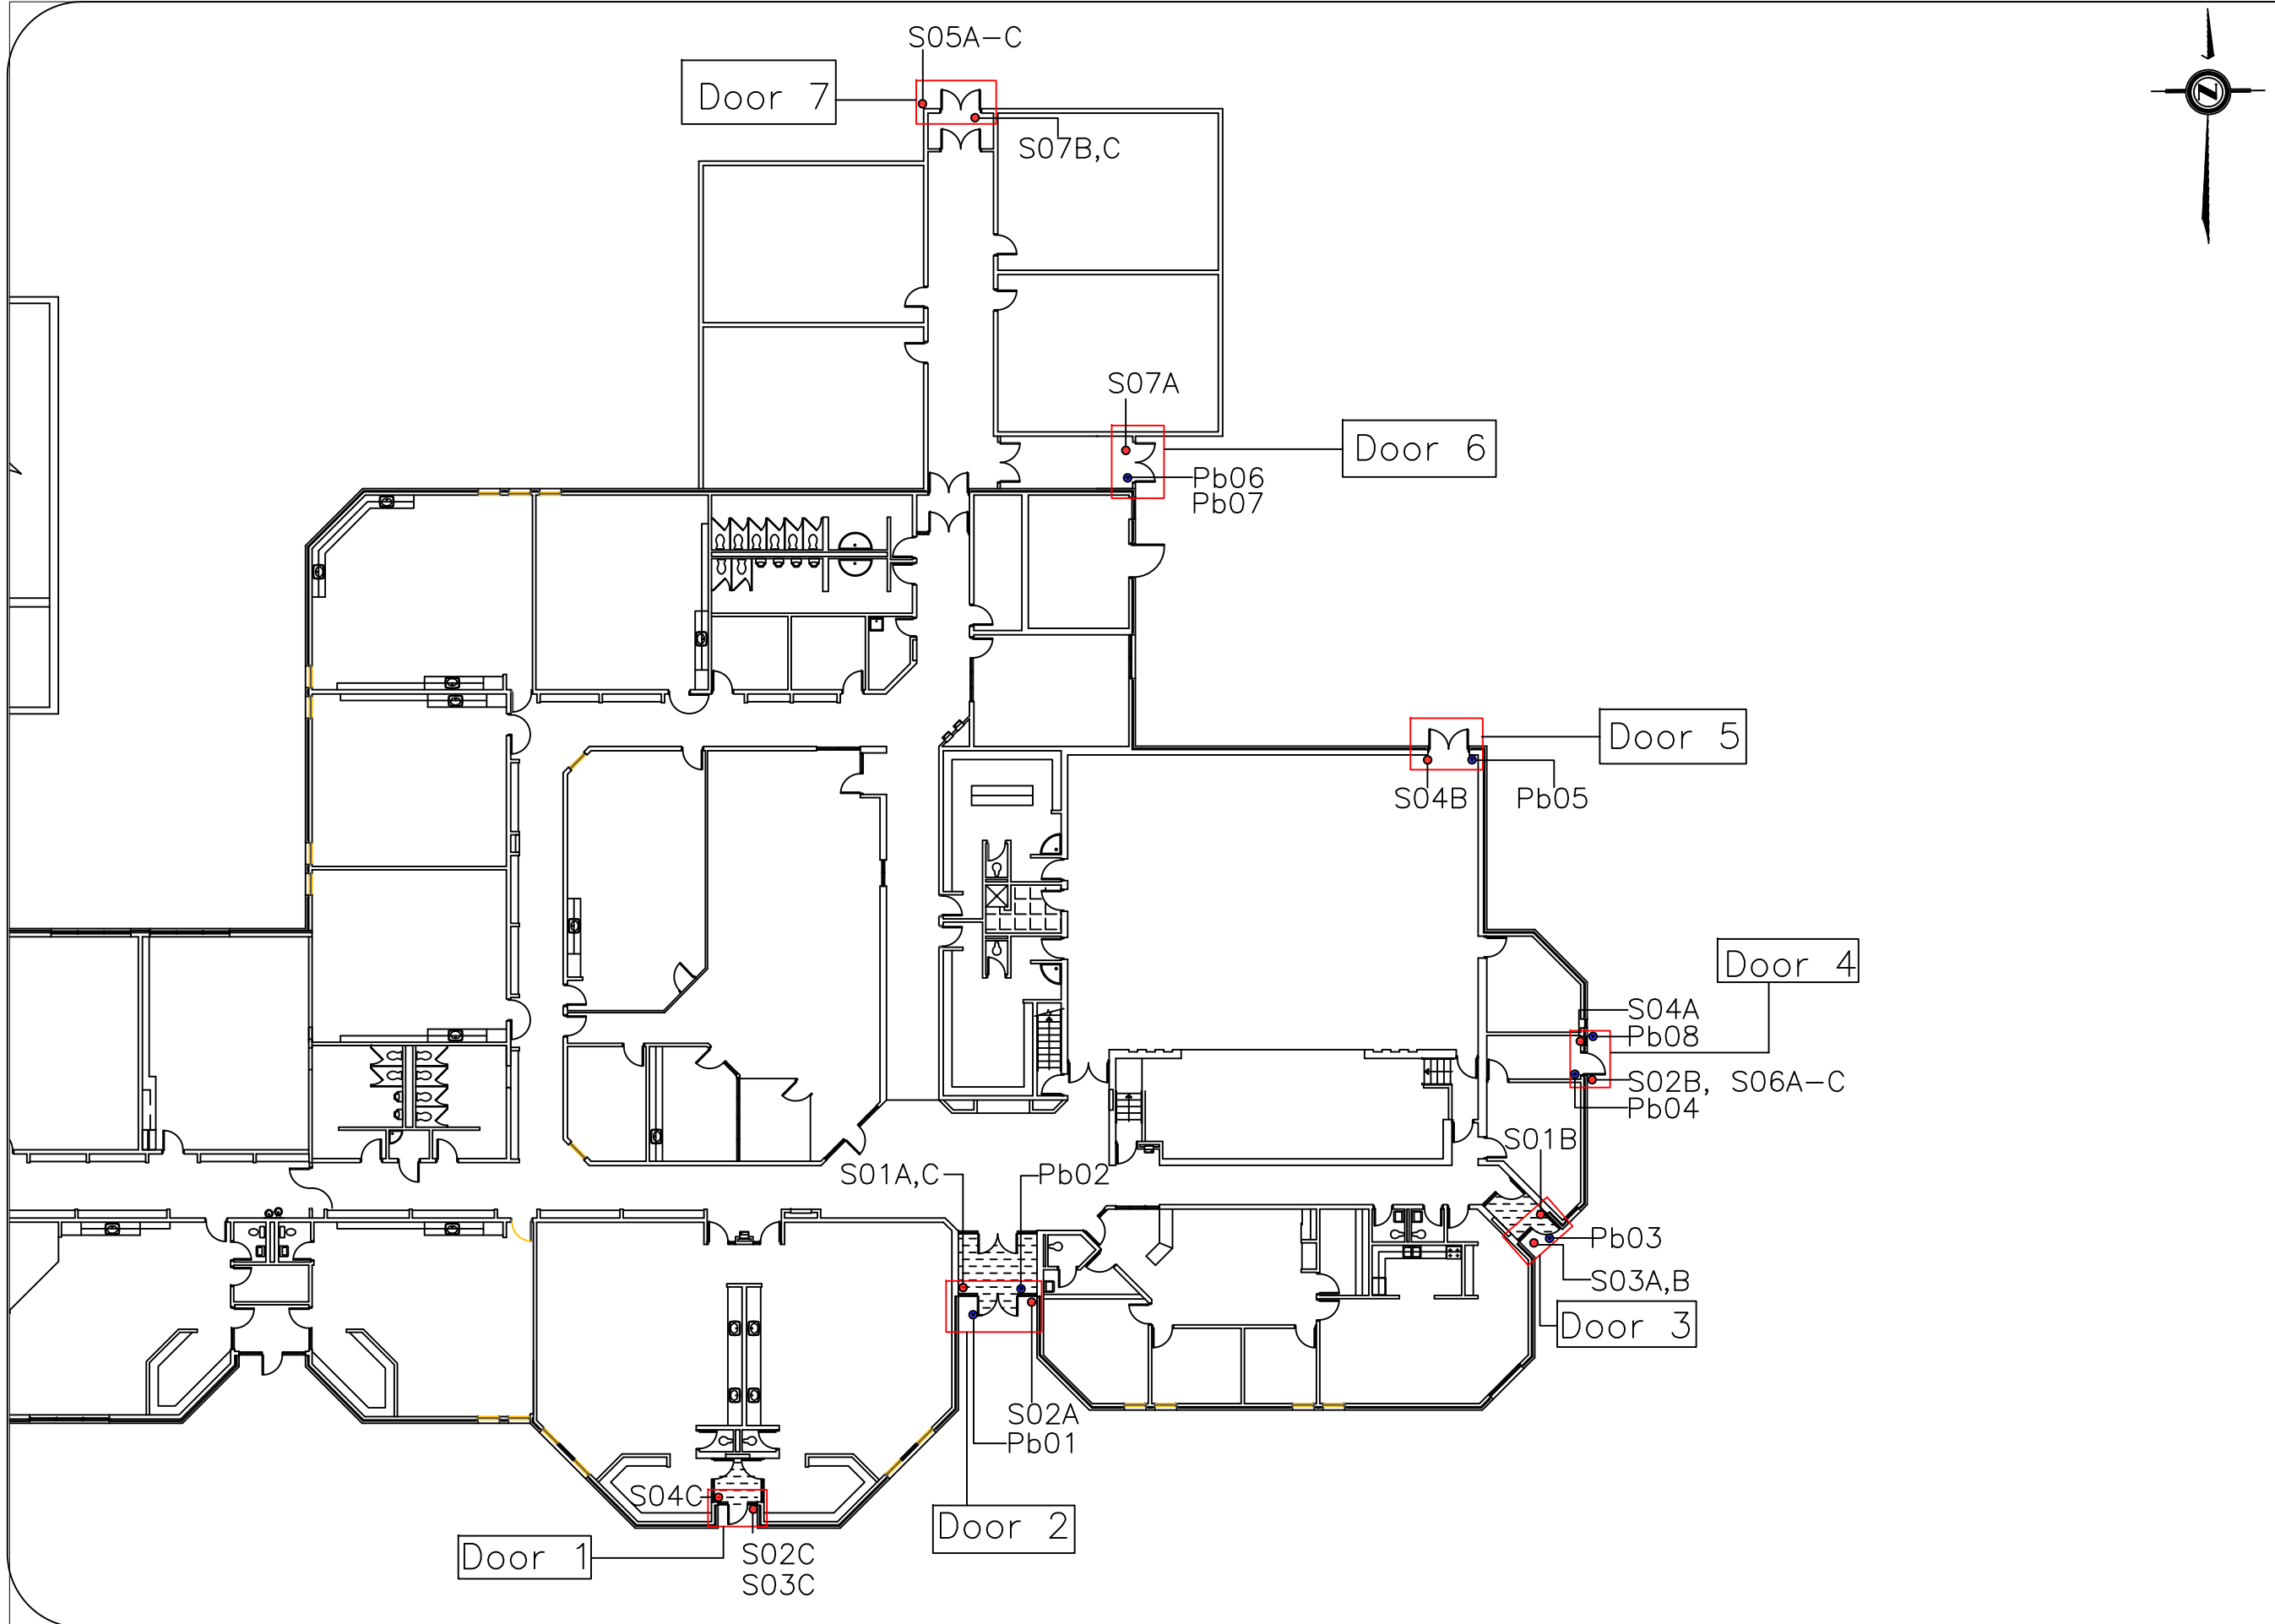

MAPLE ENVIRONMENTAL INC.
 ENVIRONMENT, HEALTH & SAFETY CONSULTANTS
 482 South Service Road East - Suite 116 - Oakville - Ontario - L6L 6W1
 Tel: 905.257.4400 - Fax: 905.257.9865
 www.MapleEnvironmental.com

LEGEND

BULK ASBESTOS SAMPLE 17114 S##	●
BULK PAINT SAMPLE 17114 Pb##	●

CONFIRMED ACM

SYMBOL	DESCRIPTION
	TEXTURE COAT
	OUTLINE OF SURVEYED AREAS

Drawn By: S. Doyle	Chkd By: J. De Sousa	Sainte Jeanne d'Arc 25 Laurelcrest Street Brampton, Ontario
-----------------------	-------------------------	---

**LIMITED DESIGNATED
 SUBSTANCE SURVEY**
 Sainte Jeanne d'Arc
 Brampton, Ontario
 Ground Floor

Project No. 17114	Sheet DS-01
Date MAY/2018	
Scale NTS	