

ASBESTOS-CONTAINING BUILDING MATERIALS RE-ASSESSMENT REPORT

I. E. Weldon Secondary School

24 Weldon Road
Lindsay, Ontario

Presented to:

Trillium Lakelands District School Board

Box 420, County Road 36
Lindsay, Ontario
K9V 4S4

Attention: Daniel Whalen

September 2020

Maple Project No. 18736-48

Executive Summary

2020 Asbestos-Containing Building Materials Re-Assessment Report

Maple Project	School Name	Address
18736-48	I.E. Weldon Secondary School	24 Weldon Road, Lindsay, Ontario

Maple Environmental Inc. was retained by Trillium Lakelands District School Board to perform a re-assessment of known asbestos-containing building materials within the subject building.

The findings and recommendations of the current assessment are summarized below. Please refer to the main body of the report for details.

FINDINGS

Asbestos-containing materials (ACM) identified within the building at the time of the assessment are as follows:

ASBESTOS BUILDING MATERIALS SUMMARY								
MATERIAL		ASBESTOS			FRIABILITY		Remedial Work Required	
		Yes	No	Suspect	Friable	Non-Friable		Potentially
Sprayed Fireproofing			X		X			NO
Textured Finish			X		X			NO
Mechanical Insulations	Pipe Fittings		X		X			NO
	Pipe Straight		X		X			NO
	Ductwork		X		X			NO
	Mechanical Equip.		X		X			NO
Ceiling Tiles			X				X	NO
Vinyl Sheet Flooring			X				X	NO
Vinyl Floor Tiles		X				X		NO
Asbestos Cement (Transite)				X		X		NO
Plaster				X			X	NO
Drywall Joint Compound		X				X		No
Other (roofing, caulking, etc.)				X		X		NO

Please refer to Room by Room Inventory in Appendix I to view location, quantities, and condition of ACM observed within the building at the time of the assessment.

Executive Summary

2020 Asbestos-Containing Building Materials Re-Assessment Report

RECOMMENDATIONS

As asbestos-containing materials were found to be present within the building, Ontario Regulation 278/05 requires that the Trillium Lakelands District School Board's Asbestos Management Plan must apply to this building. In addition, an annual re-assessment of all ACM must be performed.

All asbestos-containing materials identified within the building were observed to be in GOOD condition and therefore no immediate recommendations are warranted.

General Statement

This report should be read in its entirety and is not a stand-alone report. Please refer to the Trillium Lakelands District School Board Overview Report provided under a separate cover to review information relevant to Regulations, Inventory Scope and Methodology, Sampling Strategies, Analytical Methods, Assessment Criteria, and the assessment limitations. Further, this Executive Summary must be read in conjunction with the main body of this report below.

TABLE OF CONTENTS

EXECUTIVE SUMMARY	<i>i</i>
1.0 INTRODUCTION	1
2.0 APPLICABLE ONTARIO REGULATIONS.....	1
2.1 ONTARIO REGULATION 278/05 (ASBESTOS)	1
2.2 ONTARIO REGULATION 347	2
3.0 SURVEY SCOPE AND METHODOLOGY.....	2
3.1 INVENTORY METHODOLOGY.....	3
3.2 ASBESTOS ASSESSMENT CRITERIA	3
3.3 LIMITATIONS AND OMISSIONS FROM SCOPE	4
3.4 SAMPLING STRATEGY AND ANALYTICAL METHODS	5
3.5 DRAWINGS	6
4.0 INVENTORY FINDINGS.....	6
4.1 SPRAYED FIREPROOFING (FRIABLE).....	7
4.2 THERMAL MECHANICAL INSULATION (FRIABLE)	7
4.3 TEXTURE FINISH (FRIABLE)	7
4.4 ACOUSTIC CEILING TILES (POTENTIALLY FRIABLE).....	7
4.5 VINYL SHEET FLOORING (POTENTIALLY FRIABLE).....	8
4.6 VINYL FLOOR TILE (NON-FRIABLE)	8
4.7 ASBESTOS CEMENT PRODUCTS "TRANSITE" (NON-FRIABLE)	8
4.8 DRYWALL JOINT COMPOUND (DJC)	8
4.9 PLASTER	8
5.0 RECOMMENDATIONS	8
5.1 GENERAL RECOMMENDATIONS	8
5.2 SPECIFIC RECOMMENDATIONS	9
6.0 LIMITATIONS.....	9
 APPENDIX I	 ROOM-BY-ROOM ASBESTOS INVENTORY
APPENDIX II	DRAWINGS
APPENDIX III	POTENTIAL ASBESTOS-CONTAINING MATERIAL IDENTIFICATION SHEET

1.0 INTRODUCTION

MAPLE Environmental Inc. ("MAPLE") was retained by the Trillium Lakelands District School Board (TLDSB) to perform a re-assessment of known asbestos-containing building materials within all TLDSB schools where asbestos was previously confirmed to be present (by others).

The assessment was completed in accordance with the requirement of Ontario Regulation 278/05 to complete a re-assessment on an annual basis.

The following report presents the findings and recommendations of the assessment for the specific building listed.

SUMMARY OF BUILDING INFORMATION	
School Name:	I.E. Weldon Secondary School
Building Address:	24 Weldon Road, Lindsay, Ontario
Number of Floors:	2 (no basement)
Approximate Square Footage:	140,000
Assessed by:	Richards Reboks
Assessment Date:	July 29, 2020

2.0 APPLICABLE ONTARIO REGULATIONS

Applicable Ontario Regulations for each of the materials included in the investigation are briefly described below.

2.1 Ontario Regulation 278/05 (Asbestos)

The Ontario Ministry of Labour Regulation 278/05 requires a detailed asbestos inventory be performed in all buildings where friable and non-friable asbestos-containing materials (ACM) are present. The inventory must be available at the work place and must identify the type and location of asbestos-containing materials on a room-by-room basis, where necessary.

Each individual building report prepared by MAPLE meets or exceeds the requirements for an asbestos survey under Ontario Regulation 278/05.

Ontario Regulation 278/05 applies to buildings with regards to maintenance, renovation or demolition work where ACM is present and may be disturbed. The regulation requires all buildings where asbestos is known to be part of the building materials to implement an Asbestos Management Program

(AMP). TLDSB has prepared and maintains an AMP of which the current Re-Assessment report is part of.

2.2 Ontario Regulation 347

Ontario Regulation 347 applies to the transport of waste from the location of generation to a landfill site authorized to receive specific wastes. The regulation also prescribes procedures on how the specific wastes are to be handled at the landfill site.

The major requirements of the building owner and the person(s) removing the waste are to ensure that:

- The waste is appropriately packaged and labelled;
- The transport vehicle is appropriately placard; and
- The waste is to be transported as directly as possible to the landfill site once it leaves the site.

Some wastes require the Owner to register a Generator (of waste) number and many wastes require classification that can restrict or even prohibit their disposal in landfill.

It is important to note that the building owner can be held responsible for the waste until the waste disposal site accepts it.

3.0 SURVEY SCOPE AND METHODOLOGY

The surveys were performed on a Room-by-Room basis within each building included in the scope of the assessment where asbestos was previously identified (by others).

The scope of the surveys included all friable and major non-friable materials suspected to contain asbestos. The term friable is applied to a material that can be readily reduced to dust or powder by hand or moderate pressure. Asbestos materials that are friable have a much greater potential to release airborne asbestos fibres when disturbed.

Typical friable asbestos materials include; sprayed fireproofing or thermal insulation, textured (stippled) plaster, and thermal mechanical insulation. Typical non-friable materials include: asbestos cement (transite) products, caulking, vinyl floor tiles, asbestos textiles and gaskets. Additional materials such as ceiling tiles and drywall joint compounds are classified as non-friable, but because of their ability to release dust when disturbed they are considered as "potentially friable" for the purpose of this report.

3.1 Inventory Methodology

In order to determine the location of the materials included in the assessment, each room or area was entered where practical (i.e.: where access was possible without the demolition of walls, roof or ceilings or destruction of flooring) where asbestos materials were previously identified. An investigation of areas of the building where asbestos was not previously identified was not included in the scope of the current project.

Representative views were made above accessible suspended ceiling systems. Drywall or plaster ceilings were accessed via existing ceiling access panels only. The inventory did not include destructive testing of building systems or finishes to observe possible hidden conditions.

3.2 Asbestos Assessment Criteria

The recommendations and suggestions made as part of this report with respect to asbestos have taken into consideration the condition and accessibility of the asbestos-containing material as well as other factors such as water damage, vibration, air movement, and general activities in the area.

Where ACM is found to be in GOOD condition and not likely to deteriorate or fall, the general recommendation would be to re-evaluate the condition of the material on an annual basis (required by Regulation 278/05). This recommendation can be subject to change if the material is located in a manner that persons untrained in asbestos awareness could physically damage it.

Where the ACM is found to be damaged (i.e. FAIR or POOR condition), a recommendation to have the material cleaned-up, repaired, removed, enclosed, or encapsulated is offered. The recommendation will also indicate which asbestos procedure should be used to perform the remedial work (i.e. Type 1, Type 2, Type 3, or Glove Bag Removal Methods).

In each area or room inventoried, the quantity, condition (GOOD, FAIR, or POOR) and accessibility (A, B, C, D or E) of each suspect material was recorded.

The definitions for condition and accessibility items are as follows:

GOOD Material is intact with no visible signs of damage.

FAIR Material is visibly damaged but can be repaired.

POOR Material is damaged beyond repair and likely needs to be removed.

Access A Accessible to all occupants of the building.

- | | |
|-----------------|--|
| Access B | Accessible to Maintenance personnel without the use of a ladder (i.e. Mechanical Room, pipe chase etc.). |
| Access C | Accessible to Maintenance personnel with the use of a ladder and is exposed to view without removing building components. |
| Access D | Accessible to Maintenance personnel with the use of a ladder and is concealed from viewing due to a building component (i.e. above a removable ceiling). |
| Access E | Not accessible without demolition of a building component (i.e. above a fixed ceiling system). |

The asbestos related information collected during the previous assessments was confirmed and the room-by-room data updated to reflect the current information.

3.3 Limitations and Omissions from Scope

Due to the nature of building construction, some limitations exist in regards to the possible thoroughness of any building materials inventory. The field observations, measurements, and analysis are considered sufficient in detail and scope to form a reasonable basis for the findings presented in this report. MAPLE warrants that the findings and conclusions contained herein have been made in accordance with generally accepted evaluation methods in the industry and applicable regulations at the time of the performance of the inventory.

It is possible that conditions may exist which could not be reasonably identified within the scope of the inventory or which were not apparent during the site investigation. MAPLE believes that the information collected during the inventory period concerning the property is reliable. No other warranties are implied or expressed.

In addition, during a standard asbestos assessment, performed for the purposes of regulatory compliance, it is industry practice to exclude some non-friable materials in the inventory. Examples of such assumptions include; elevator brakes, roofing felts and mastics, high voltage wiring, mechanical packing and gaskets, underground services or piping, fire-doors, window caulking, levelling compound, and/or materials used in operating equipment. As such, these materials were not sampled at the time of this survey and where present are assumed to be asbestos containing until proven otherwise.

3.4 Sampling Strategy and Analytical Methods

As the majority of materials were previously sampled by others, the requirement for sampling during the current survey was limited. Where samples were collected, they conformed to the criteria outlined below and in compliance with O. Reg. 278/05.

A small volume of the material was removed either from a damaged section or cut out of intact material and then repaired by sealing with tape to prevent the release of fibres. The collected samples were placed in plastic bags, sealed and labelled and then sent to an independent laboratory for analysis. To ensure quality results, the independent laboratory chosen is NVLAP accredited and successfully participates in an "Asbestos Proficiency Analytical Testing Program" and as such, these laboratories are responsible for their findings.

The collection of samples was performed in accordance with regulatory sampling requirements and with sufficient frequency to obtain a general pattern of asbestos use within the building. Due to building renovations or modifications that have occurred, the consistency of the application of asbestos materials may not be uniform throughout the entire building. It is important to note that without sampling every wall, pipe section, ceiling tile etc. it is not possible to identify the possible asbestos content in every material present in the building. For this reason, materials similar in appearance to those sampled elsewhere in the building were visually identified as being homogeneous and thus are assumed to be composed of the same material, thus additional sampling is not required.

In accordance with Reg. 278/05, samples were collected at the following frequency.

Material Type	No. Samples
Sprayed Fireproofing	Up to 7
Texture Coat	Up to 7
Pipe Fitting Insulation	3
Pipe Straight Insulation	3
Ductwork Insulation	3
Ceiling Tiles	3
Vinyl Sheeting Flooring	3
Vinyl Floor Tile	3
Plaster Finishes	Up to 7
Drywall Compound	Up to 7

An independent NVLAP accredited laboratory, was used to analyse the collected samples. Analysis was performed following the Code of Practice for the identification of asbestos in bulk material, as detailed in Ontario Regulation 278/05. Bulk samples were analysed using the Polarized Light Microscopy ("PLM") Technique with Dispersion Staining. The identification of asbestos fibre in bulk material is based on a collective set of parameters dependent on the unique shape and crystallographic properties of each fibre as viewed through the microscope. This method is useful for the qualitative identification of asbestos and the semi-quantitative determination of asbestos content in bulk materials expressed as a percent of projected area. The method identifies types of asbestos and also measures percent of asbestos as perceived by the analyst in comparison to standard area projections or trained experience.

Given the composition of some vinyl floor products, the PLM analysis method is often prone to yielding false negative analysis results. Therefore it may be prudent that the Transmission Electron Microscopy (TEM) analysis method be used to determine the asbestos content in the vinyl floor products, if negative results are obtain from the laboratory analysis.

3.5 Drawings

Drawings provided for each building indicate the following (where present):

- ◇ Location Numbers (reference to Room-by-Room asbestos data)
- ◇ Asbestos-Containing Sprayed Fireproofing
- ◇ Asbestos-Containing Texture Finishes
- ◇ Asbestos-Containing Ceiling Tiles
- ◇ Asbestos-Containing Flooring Materials
- ◇ Presence of Asbestos-Containing Mechanical Insulations will not be specifically indicated on the drawings; however, a general statement regarding the presence of ACM mechanical insulations, where present, has been indicated on the drawings.
- ◇ Presence of asbestos-containing drywall joint compound and hard plaster will not be specifically identified on the drawings; however, a general statement regarding the presence of these ACM materials, where present, has been indicated on the drawings.

4.0 INVENTORY FINDINGS

The following is a brief discussion of the extent to which Asbestos-Containing Materials (ACM) was identified in the building. The discussion is organized under the headings of materials that are generally suspected of containing asbestos. Refer to the Room-by-Room Survey Inventory in Appendix I for a detailed description and location of all ACM.

Destructive testing was not conducted and as such some areas within the building were not accessible for an assessment (i.e. above solid ceilings, behind walls). Access for viewing within wall and ceiling cavities was not always possible. Suspect asbestos materials may be present within ceiling and wall cavities that were not identified in this report. This comment is particularly important for materials such as mechanical insulation. Caution should be taken when demolishing solid wall finishes within the building.

4.1 Sprayed Fireproofing (Friable)

No asbestos-containing sprayed fireproofing was observed in the building. The sprayed fire proofing previously identified in several locations was determined to be non-asbestos.

4.2 Thermal Mechanical Insulation (Friable)

No asbestos-containing mechanical insulations are present in the building. It is important to note that mechanical systems may be present within walls and ceiling cavities or pipe chases that were not accessible during this assessment. The presence of ACM mechanical insulations in these locations should be suspected.

Pipe Systems:

Pipe Fittings, where insulated are insulated with non-asbestos fibreglass and/or armaflex materials.

Pipe Straights, where insulated are insulated with non-asbestos fibreglass and/or armaflex materials.

Ductwork:

Duct systems were either insulated with non-asbestos fibreglass or were un-insulated.

Mechanical Equipment:

Mechanical equipment was observed to be externally un-insulated.

4.3 Texture Finish (Friable)

No asbestos-containing texture finishes were identified to be present within the building.

4.4 Acoustic Ceiling Tiles (Potentially Friable)

No asbestos-containing ceiling tiles were identified to be present within the building.

4.5 Vinyl Sheet Flooring (Potentially Friable)

No asbestos-containing vinyl sheet flooring was identified to be present within the building.

4.6 Vinyl Floor Tile (Non-Friable)

Vinyl floor tiles containing asbestos are present in various areas of the building. All tiles were found to be in GOOD condition. Additionally, black mastic associated with vinyl floor tiles has been identified as asbestos-containing. Refer to the Room-by-Room Inventory in Appendix I for details regarding location and quantity.

4.7 Asbestos Cement Products "Transite" (Non-Friable)

Suspect asbestos-containing transite is present in the form of rain water leaders and roof drains within Room 164 (eBase 116) as well as panels on the building exterior. It should be noted that transite pipes were identified in areas not previously identified. Maple conducted some level of additional investigation for transite but did not enter all rooms in the building. Caution should be taken when performing work on rain water leaders. All transite was found to be in GOOD condition. Refer to the Room-by-Room Inventory in Appendix I for details regarding location and quantity.

4.8 Drywall Joint Compound (DJC)

Previous sample results indicated drywall joint compound sampled at the Site contains asbestos. All drywall should be assumed to contain asbestos unless testing in specific areas indicates otherwise. The drywall was found to be in GOOD condition.

4.9 Plaster

While previous sample results indicated all plaster finishes sampled at the Site does not contain asbestos, note that the concentration of asbestos within plaster is historically known to be potentially inconsistently distributed. Further, it is possible that various phases of construction and renovations have occurred at the Site. Therefore, the number of samples previously collected may not be representative of all plaster finishes in the building.

5.0 RECOMMENDATIONS

5.1 General Recommendations

Due to the presence of ACM within the building, TLDSB must maintain their existing Asbestos Management Program for this property.

A re-assessment of known ACM is to be conducted at least once annually.

It is important to note that due to the presence of solid walls and ceiling systems, ACM may be present in concealed locations not identified in this report.

If asbestos-containing vinyl floor tiles are likely to be disturbed, the tiles should be removed using Type 1 Asbestos procedures (provided no power tools are used and the material is wetted). The use of power tools would require Type 3 Asbestos procedures.

Removal or disturbance of asbestos-containing mastic associated with vinyl floor tiles requires the use of Type 1 Asbestos procedures (provided no power tools are used and the material is wetted). If power tools are required Type 3 Asbestos procedures apply.

Asbestos-containing drywall joint compound is present within the building. Removal or disturbance of less than 1 m² of this material will require the use of Type 1 Asbestos procedures, and the disturbance of greater than less than 1 m² will require Type 2 Asbestos procedures.

Removal or disturbance of transite cement products requires the use of Type 1 Asbestos procedures (provided no power tools are used and the material is wetted). If power tools are required Type 3 Asbestos procedures need be applied.

Materials suspected of containing asbestos should be sampled prior to disturbance. Suspect materials include; drywall joint compound, plaster, roofing materials, caulking, etc. unless previously confirmed to contain asbestos.

5.2 Specific Recommendations

All ACM was identified in GOOD condition. As such no immediate recommendations are warranted at this time.

6.0 LIMITATIONS

Due to the nature of building construction some limitations exist as to the possible thoroughness of the subject investigation. The field observations are considered sufficient in detail and scope to form a reasonable basis for the findings presented in this report. MAPLE warrants that the findings and conclusions contained herein have been made in accordance with generally accepted evaluation methods in the industry and applicable regulations at the time of the performance of the assessment.

It is possible that conditions may exist which could not be reasonably identified within the scope of the investigation or which were not apparent during the site investigation. MAPLE believes that the information collected during the investigation period concerning the property is reliable. No other warranties are implied or expressed.

Information provided by Maple is intended for Client use only. Any use by a third party, of reports or documents authored by Maple, or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Maple accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted.

The liability of Maple or its staff will be limited to the lesser of the fees paid or actual damages incurred by the Client. Maple will not be responsible for any consequential or indirect damages. Maple will only be liable for damages resulting from negligence of Maple; all claims by the Client shall be deemed relinquished if not made within two years after last date of services provided. Please contact Maple Environmental Inc. at (905) 257-4408 for inquiries regarding this project.

Sincerely,

MAPLE ENVIRONMENTAL INC.
Environment, Health and Safety Consultants

Prepared By:



Richards Reboks
Senior Project Technologist

Reviewed By:




Kyle Prosser
Senior Project Manager


C:\Users\Daniel Prosia\Google Drive\18700 - 18799\18736 TLDSB, 2020 Reassessment, ACM\Schools (Asbestos)\IE Weldon\18736-48 IE Weldon SS Report.doc

APPENDIX I
ROOM-BY-ROOM ASBESTOS INVENTORY


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Capostite PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile VSC: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking										
					CONDITION G: Good F: Fair P: Poor														
ID	Facility	Floor #	Room #	Room name	Has ACM	Frivable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
44762	IE Weldon Secondary School	NA		EXTERIOR	No	No	RF	RM	N/A	ACM ASSUMED	1	G	NS		C				sample prior to renovation
44763	IE Weldon Secondary School	NA		EXTERIOR	No	No	WN	WC	N/A	ACM ASSUMED	1	G	NS		A, C				sample prior to renovation
44764	IE Weldon Secondary School	NA		EXTERIOR	Suspect	No	WN	TB	N/A	ACM ASSUMED	1	G	NS		A, C				sample prior to renovation
44775	IE Weldon Secondary School	1	101A	Stairs 2	No	Yes	WL	TF		N/D	-	-	40-BS-01C		-				
44776	IE Weldon Secondary School	1	101A	Stairs 2	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44777	IE Weldon Secondary School	1	101A	Stairs 2	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44765	IE Weldon Secondary School	1	102	Lobby	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44766	IE Weldon Secondary School	1	102	Lobby	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		C				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44767	IE Weldon Secondary School	1	102	Lobby	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44768	IE Weldon Secondary School	1	103	Main Office	No	No	FL	VFT	1	N/D	-	-	V/C:40-BS-05		-				
44769	IE Weldon Secondary School	1	103	Main Office	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44770	IE Weldon Secondary School	1	103	Main Office	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44771	IE Weldon Secondary School	1	103	Main Office	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44785	IE Weldon Secondary School	1	103A	Room 01	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44786	IE Weldon Secondary School	1	103A	Room 01	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44787	IE Weldon Secondary School	1	103A	Room 01	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44788	IE Weldon Secondary School	1	103B	Room 02	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44789	IE Weldon Secondary School	1	103B	Room 02	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44790	IE Weldon Secondary School	1	103B	Room 02	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44791	IE Weldon Secondary School	1	103C	Room 03	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44792	IE Weldon Secondary School	1	103C	Room 03	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44793	IE Weldon Secondary School	1	103C	Room 03	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44794	IE Weldon Secondary School	1	103D	Room 04	No	No	FL	VFT	1	N/D	-	-	V/C:40-BS-05		-				
44795	IE Weldon Secondary School	1	103D	Room 04	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44796	IE Weldon Secondary School	1	103D	Room 04	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44797	IE Weldon Secondary School	1	103D	Room 04	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44798	IE Weldon Secondary School	1	103E	Room 05	No	No	FL	VFT	6	N/D	-	-	V/C:40-BS-11		-				
44799	IE Weldon Secondary School	1	103E	Room 05	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44800	IE Weldon Secondary School	1	103E	Room 05	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44801	IE Weldon Secondary School	1	103E	Room 05	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44802	IE Weldon Secondary School	1	103F	Room 06	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44803	IE Weldon Secondary School	1	103F	Room 06	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44804	IE Weldon Secondary School	1	103F	Room 06	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
45212	IE Weldon Secondary School	1	104	Hallway H10	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45222	IE Weldon Secondary School	1	104	Hallway H10	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
45231	IE Weldon Secondary School	1	104	Hallway H10	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44805	IE Weldon Secondary School	1	105	Room G (Guidance)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44806	IE Weldon Secondary School	1	105	Room G (Guidance)	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44807	IE Weldon Secondary School	1	105	Room G (Guidance)	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44808	IE Weldon Secondary School	1	105A	Room G1	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44809	IE Weldon Secondary School	1	105A	Room G1	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44810	IE Weldon Secondary School	1	105A	Room G1	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				
44811	IE Weldon Secondary School	1	105B	Room G2	No	No	FL	VFT	6	N/D	-	-	V/C:40-BS-11		-				
44812	IE Weldon Secondary School	1	105B	Room G2	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
44813	IE Weldon Secondary School	1	105B	Room G2	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07		-				
44814	IE Weldon Secondary School	1	105B	Room G2	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21		-				


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

		STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical			ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems			TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor			N/A: Not Applicable N/Anz: Not Analyzed PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite			PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish			TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile			VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking		
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes			
44815	IE Weldon Secondary School	1	105C	Room G3	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44816	IE Weldon Secondary School	1	105C	Room G3	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44817	IE Weldon Secondary School	1	105C	Room G3	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44818	IE Weldon Secondary School	1	105D	Room G4	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-						
44819	IE Weldon Secondary School	1	105D	Room G4	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44820	IE Weldon Secondary School	1	105D	Room G4	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44821	IE Weldon Secondary School	1	105D	Room G4	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44822	IE Weldon Secondary School	1	105E	Room G5	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44823	IE Weldon Secondary School	1	105E	Room G5	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44824	IE Weldon Secondary School	1	105E	Room G5	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44825	IE Weldon Secondary School	1	105F	Room G6	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-						
44826	IE Weldon Secondary School	1	105F	Room G6	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44827	IE Weldon Secondary School	1	105F	Room G6	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44828	IE Weldon Secondary School	1	105F	Room G6	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44829	IE Weldon Secondary School	1	105G	Room G7	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44830	IE Weldon Secondary School	1	105G	Room G7	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44831	IE Weldon Secondary School	1	105G	Room G7	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44832	IE Weldon Secondary School	1	105H	Room G8	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44833	IE Weldon Secondary School	1	105H	Room G8	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44834	IE Weldon Secondary School	1	105H	Room G8	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44835	IE Weldon Secondary School	1	105I	Room G9	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44836	IE Weldon Secondary School	1	105I	Room G9	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44837	IE Weldon Secondary School	1	105I	Room G9	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44838	IE Weldon Secondary School	1	105J	Room G10	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44839	IE Weldon Secondary School	1	105J	Room G10	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44840	IE Weldon Secondary School	1	105J	Room G10	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44841	IE Weldon Secondary School	1	105K	Room G12	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44842	IE Weldon Secondary School	1	105K	Room G12	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44843	IE Weldon Secondary School	1	105K	Room G12	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44844	IE Weldon Secondary School	1	105L	Room G13	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03G			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44845	IE Weldon Secondary School	1	105L	Room G13	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
44846	IE Weldon Secondary School	1	105L	Room G13	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44851	IE Weldon Secondary School	1	105M	Room 104 (Staff WS)	Yes	No	CL	DJC		0.75% -1% Chrysotile	80 SF	G	V/C:40-B5-03			C			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44852	IE Weldon Secondary School	1	105M	Room 104 (Staff WS)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44853	IE Weldon Secondary School	1	105N	Room 105 (Staff WS)	Yes	No	CL	DJC		0.75% -1% Chrysotile	80 SF	G	V/C:40-B5-03			C			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44854	IE Weldon Secondary School	1	105N	Room 105 (Staff WS)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44849	IE Weldon Secondary School	1	107	Room 102 (Washroom)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
44850	IE Weldon Secondary School	1	107	Room 102 (Washroom)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44847	IE Weldon Secondary School	1	108	Room 101 (Washroom)	No	-	CL	DJC			-	-				ACM DJC removed July 22, Maple Project						
44848	IE Weldon Secondary School	1	108	Room 101 (Washroom)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
44993	IE Weldon Secondary School	1	109	Room 153A	No	-	-	-	-	-	-	-	-			-			ACM and/or PACM not observed			
44998	IE Weldon Secondary School	1	109A	Room 153 C	No	No	FL	VFT	1	N/D	-	-	40-B5-05A			-						
44999	IE Weldon Secondary School	1	109A	Room 153 C	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
45000	IE Weldon Secondary School	1	109A	Room 153 C	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
45001	IE Weldon Secondary School	1	109A	Room 153 C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						
45002	IE Weldon Secondary School	1	109B	Room 153 D	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-						
45003	IE Weldon Secondary School	1	109B	Room 153 D	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile			
45004	IE Weldon Secondary School	1	109B	Room 153 D	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-						
45005	IE Weldon Secondary School	1	109B	Room 153 D	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-						


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Capostite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish		TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile		VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking		
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45006	IE Weldon Secondary School	1	109C	Room 153 E	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45007	IE Weldon Secondary School	1	109C	Room 153 E	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
44994	IE Weldon Secondary School	1	110	Room 153B	No	-	-	-	-	-	-	-	-		-				ACM and/or PACM not observed
45008	IE Weldon Secondary School	1	110A	Room 153F	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45009	IE Weldon Secondary School	1	110A	Room 153F	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45010	IE Weldon Secondary School	1	110A	Room 153F	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45011	IE Weldon Secondary School	1	110A	Room 153F	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45012	IE Weldon Secondary School	1	110B	Room 153G	No	No	FL	VFT	5	N/D	-	-	V/C:40-B5-10		-				
45013	IE Weldon Secondary School	1	110B	Room 153G	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45014	IE Weldon Secondary School	1	110B	Room 153G	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45015	IE Weldon Secondary School	1	110B	Room 153G	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
44996	IE Weldon Secondary School	1	110C	Room 153I	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed
44995	IE Weldon Secondary School	1	110D	Room 153H	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed
45032	IE Weldon Secondary School	1	111	Room 157	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45033	IE Weldon Secondary School	1	111	Room 157	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45034	IE Weldon Secondary School	1	111	Room 157	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45035	IE Weldon Secondary School	1	111	Room 157	No	Yes	ST	SFP		N/D	-	-	40-B5-21A		-				
45036	IE Weldon Secondary School	1	111A	Room 157 A	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45037	IE Weldon Secondary School	1	111A	Room 157 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45038	IE Weldon Secondary School	1	111A	Room 157 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45039	IE Weldon Secondary School	1	111A	Room 157 A	No	Yes	ST	SFP		N/D	-	-	40-B5-21C		-				
45047	IE Weldon Secondary School	1	112	Room 165	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed
44997	IE Weldon Secondary School	1	112A	Room 153J	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed
45207	IE Weldon Secondary School	1	113	Hallway H3	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45216	IE Weldon Secondary School	1	113	Hallway H3	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45226	IE Weldon Secondary School	1	113	Hallway H3	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45040	IE Weldon Secondary School	1	115	Room 163	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45041	IE Weldon Secondary School	1	115A	Room 163A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45042	IE Weldon Secondary School	1	115B	Room 163B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45043	IE Weldon Secondary School	1	116	Room 164	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45501	IE Weldon Secondary School	1	116	Room 164	Yes	No	PI	TP		ACM ASSUMED	8 LF	G	N/S		D				
45045	IE Weldon Secondary School	1	116A	Room 164 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45046	IE Weldon Secondary School	1	116A	Room 164 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45044	IE Weldon Secondary School	1	116B	Room 164B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45048	IE Weldon Secondary School	1	117	Room 166 (Girls WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45049	IE Weldon Secondary School	1	117	Room 166 (Girls WR)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45050	IE Weldon Secondary School	1	118	Room 167 (Boys WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45051	IE Weldon Secondary School	1	118	Room 167 (Boys WR)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45052	IE Weldon Secondary School	1	119	Room 168 (Custodian Room)	No	No	FL	VFT	5	N/D	-	-	40-B5-10B,C		-				
45053	IE Weldon Secondary School	1	119	Room 168 (Custodian Room)	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45054	IE Weldon Secondary School	1	119	Room 168 (Custodian Room)	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45055	IE Weldon Secondary School	1	119	Room 168 (Custodian Room)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45064	IE Weldon Secondary School	1	120	Room 170	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03C		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45065	IE Weldon Secondary School	1	120	Room 170	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45066	IE Weldon Secondary School	1	120	Room 170	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45071	IE Weldon Secondary School	1	121	Room 172	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45072	IE Weldon Secondary School	1	121	Room 172	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45073	IE Weldon Secondary School	1	121A	Room 172 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45074	IE Weldon Secondary School	1	121A	Room 172 A	No	Yes	SPF	SFP		N/D	-	-	V/C:40-B5-21		-				
45075	IE Weldon Secondary School	1	121B	Room 172 B	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45076	IE Weldon Secondary School	1	121B	Room 172 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				
45077	IE Weldon Secondary School	1	121C	Room 172 C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-				


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish		TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile		VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
	ID	Facility	Floor #	Room #	Room name	Has ACM	Frable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45089	IE Weldon Secondary School	1	122	Room 174	No	No	FL	VFT	6	N/D	-	-	40-B5-11C			-				
45090	IE Weldon Secondary School	1	122	Room 174	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45091	IE Weldon Secondary School	1	122	Room 174	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16			-				
45092	IE Weldon Secondary School	1	122	Room 174	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45093	IE Weldon Secondary School	1	122A	Room 174 A	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-				
45094	IE Weldon Secondary School	1	122A	Room 174 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45095	IE Weldon Secondary School	1	122A	Room 174 A	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16			-				
45096	IE Weldon Secondary School	1	122A	Room 174 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45206	IE Weldon Secondary School	1	123	Hallway H2	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45215	IE Weldon Secondary School	1	123	Hallway H2	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45225	IE Weldon Secondary School	1	123	Hallway H2	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
44778	IE Weldon Secondary School	1	124	Stairs 3	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
44779	IE Weldon Secondary School	1	124	Stairs 3	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45100	IE Weldon Secondary School	1	125	Room 176	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16			-				
45102	IE Weldon Secondary School	1	125	Room 176	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45101	IE Weldon Secondary School	1	126	Room 178	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16			-				
45103	IE Weldon Secondary School	1	126	Room 178	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45078	IE Weldon Secondary School	1	127	Room 173 (Boys CR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45079	IE Weldon Secondary School	1	127	Room 173 (Boys CR)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45205	IE Weldon Secondary School	1	128	Hallway H1	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45214	IE Weldon Secondary School	1	128	Hallway H1	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45224	IE Weldon Secondary School	1	128	Hallway H1	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45126	IE Weldon Secondary School	1	129	Room 183 (Girls CR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45127	IE Weldon Secondary School	1	129	Room 183 (Girls CR)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45131	IE Weldon Secondary School	1	130	Room 185	No	No	FL	VFT	7	N/D	-	-	40-B5-12B			-				
45132	IE Weldon Secondary School	1	130	Room 185	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45133	IE Weldon Secondary School	1	130	Room 185	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45134	IE Weldon Secondary School	1	130	Room 185	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45135	IE Weldon Secondary School	1	130A	Room 185 A	No	No	FL	VFT	7	N/D	-	-	40-B5-12AC			-				
45136	IE Weldon Secondary School	1	130A	Room 185 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45137	IE Weldon Secondary School	1	130A	Room 185 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45138	IE Weldon Secondary School	1	130A	Room 185 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45123	IE Weldon Secondary School	1	131	Room 182 (Gym)	-	-	-	-	-	-	-	-	-			-			ACM and/orPACM not observed	
45124	IE Weldon Secondary School	1	131A	Room 182A	-	-	-	-	-	-	-	-	-			-			ACM and/orPACM not observed	
45125	IE Weldon Secondary School	1	131B	Room 182B	-	-	-	-	-	-	-	-	-			-			ACM and/orPACM not observed	
45203	IE Weldon Secondary School	1	132	Hallway H5	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45204	IE Weldon Secondary School	1	132	Hallway H5	No	No	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45217	IE Weldon Secondary School	1	132	Hallway H5	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45139	IE Weldon Secondary School	1	133	Room 186	No	No	FL	VFT	9	N/D	-	-	40-B5-14B			-				
45140	IE Weldon Secondary School	1	133	Room 186	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45141	IE Weldon Secondary School	1	133	Room 186	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45142	IE Weldon Secondary School	1	133	Room 186	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45143	IE Weldon Secondary School	1	133A	Room 186 A	No	No	FL	VFT	9	N/D	-	-	40-B5-14A			-				
45144	IE Weldon Secondary School	1	133A	Room 186 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45145	IE Weldon Secondary School	1	133A	Room 186 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-				
45146	IE Weldon Secondary School	1	133A	Room 186 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				
45147	IE Weldon Secondary School	1	133B	Room 186 B	No	No	FL	VFT	9	N/D	-	-	40-B5-14C			-				
45148	IE Weldon Secondary School	1	133B	Room 186 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile	
45149	IE Weldon Secondary School	1	133B	Room 186 B	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16			-				
45150	IE Weldon Secondary School	1	133B	Room 186 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-				


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

		STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck			ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems			TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor			N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite			PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish			TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile			VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking		
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes			
45151	IE Weldon Secondary School	1	134	Room 187	No	No	FL	VFT	9	N/D	-	-	V/C:40-BS-14C			-						
45152	IE Weldon Secondary School	1	134	Room 187	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-BS-03D			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45153	IE Weldon Secondary School	1	134	Room 187	No	No	CL	CT	1	N/D	-	-	40-BS-07C			-						
45154	IE Weldon Secondary School	1	134	Room 187	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45155	IE Weldon Secondary School	1	135	Room 188	Yes	No	FL	VFT	11	2% Chrysotile	94 SF	G	40-BS-17A			A						
45156	IE Weldon Secondary School	1	135	Room 188	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	40-BS-03E			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45157	IE Weldon Secondary School	1	135	Room 188	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45500	IE Weldon Secondary School	1	135	Room 188	No	No	FL	VFT	11	Chrysotile	0		V/C 40-BS-17A						2018 Survey/Replaced with non-ACM: 2017 July 2017-tiles chipping, consider removing entire floor.			
44780	IE Weldon Secondary School	1	136	Stairs 4	No	Yes	WL	TF		N/D	-	-	V/C:40-BS-01			-						
44781	IE Weldon Secondary School	1	136	Stairs 4	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
44782	IE Weldon Secondary School	1	136	Stairs 4	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07			-						
45158	IE Weldon Secondary School	1	137	Room 188 A	No	No	FL	VFT	2	N/D	-	-	V/C:40-BS-06			-						
45159	IE Weldon Secondary School	1	137	Room 188 A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45160	IE Weldon Secondary School	1	137	Room 188 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45165	IE Weldon Secondary School	1	138	Room 190	No	No	FL	VFT	2	N/D	-	-	V/C:40-BS-06			-						
45166	IE Weldon Secondary School	1	138	Room 190	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45167	IE Weldon Secondary School	1	138	Room 190	No	No	CL	CT	2	N/D	-	-	V/C:40-BS-16			-						
45168	IE Weldon Secondary School	1	138	Room 190	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45169	IE Weldon Secondary School	1	139	Room 191	No	No	FL	VFT	2	N/D	-	-	V/C:40-BS-06			-						
45170	IE Weldon Secondary School	1	139	Room 191	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45171	IE Weldon Secondary School	1	139	Room 191	No	No	CL	CT	2	N/D	-	-	V/C:40-BS-16			-						
45172	IE Weldon Secondary School	1	139	Room 191	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45208	IE Weldon Secondary School	1	140	Hallway H6	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45218	IE Weldon Secondary School	1	140	Hallway H6	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07			-						
45227	IE Weldon Secondary School	1	140	Hallway H6	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45177	IE Weldon Secondary School	1	141	Room 193	No	No	FL	VFT	10	N/D	-	-	40-BS-15C			-						
45178	IE Weldon Secondary School	1	141	Room 193	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45179	IE Weldon Secondary School	1	141	Room 193	No	No	CL	CT	2	N/D	-	-	40-BS-16C			-						
45180	IE Weldon Secondary School	1	141	Room 193	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45188	IE Weldon Secondary School	1	142	Room 195	No	No	FL	VFT	10	N/D	-	-	40-BS-15A			-						
45189	IE Weldon Secondary School	1	142	Room 195	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45190	IE Weldon Secondary School	1	142	Room 195	No	No	CL	CT	2	N/D	-	-	40-BS-16B			-						
45191	IE Weldon Secondary School	1	142	Room 195	No	No	ST	SFP		N/D	-	-	V/C: 40-BS-21			-						
44783	IE Weldon Secondary School	1	143	Stairs 5	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
44784	IE Weldon Secondary School	1	143	Stairs 5	No	No	CL	CT	1	N/D	-	-	V/C:40-BS-07			-						
45184	IE Weldon Secondary School	1	144	Room 194	No	No	FL	VFT	10	N/D	-	-	40-BS-15B			-						
45185	IE Weldon Secondary School	1	144	Room 194	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45186	IE Weldon Secondary School	1	144	Room 194	No	No	CL	CT	2	N/D	-	-	40-BS-16A			-						
45187	IE Weldon Secondary School	1	144	Room 194	No	No	ST	SFP		N/D	-	-	V/C: 40-BS-21			-						
45173	IE Weldon Secondary School	1	145	Room 192	No	No	FL	VFT	12	N/D	-	-	40-BS-18A			-						
45174	IE Weldon Secondary School	1	145	Room 192	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45175	IE Weldon Secondary School	1	145	Room 192	No	No	CL	CT	2	N/D	-	-	V/C:40-BS-16			-						
45176	IE Weldon Secondary School	1	145	Room 192	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						
45161	IE Weldon Secondary School	1	146	Room 189	No	No	FL	VFT	12	N/D	-	-	40-BS-18B,C			-						
45162	IE Weldon Secondary School	1	146	Room 189	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-BS-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile			
45163	IE Weldon Secondary School	1	146	Room 189	No	No	CL	CT	2	N/D	-	-	V/C:40-BS-16			-						
45164	IE Weldon Secondary School	1	146	Room 189	No	Yes	ST	SFP		N/D	-	-	V/C:40-BS-21			-						


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
	ID	Facility	Floor #	Room #	Room name	Has ACM	Frable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes								
45209	IE Weldon Secondary School	1	147	Hallway H7	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45219	IE Weldon Secondary School	1	147	Hallway H7	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45228	IE Weldon Secondary School	1	147	Hallway H7	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45194	IE Weldon Secondary School	1	148	Room 197 (Girls WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45195	IE Weldon Secondary School	1	148	Room 197 (Girls WR)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45192	IE Weldon Secondary School	1	149	Room 196 (Boys WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45193	IE Weldon Secondary School	1	149	Room 196 (Boys WR)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
44968	IE Weldon Secondary School	1	150	Room 138	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-												
44969	IE Weldon Secondary School	1	150	Room 138	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44970	IE Weldon Secondary School	1	150	Room 138	No	No	CL	CT	1	None-Detected	-	-	V/C:40-B5-07			-												
44971	IE Weldon Secondary School	1	150	Room 138	No	Yes	ST	SFP		None-Detected	-	-	V/C:40-B5-21			-												
45210	IE Weldon Secondary School	1	151	Hallway H8	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45220	IE Weldon Secondary School	1	151	Hallway H8	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45229	IE Weldon Secondary School	1	151	Hallway H8	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44961	IE Weldon Secondary School	1	152	Room 136	No	No	FL	VFT	4	N/D	-	-	V/C:40-B5-09A,B,C			-			vft-4 was not observed during this reassessment									
44962	IE Weldon Secondary School	1	152	Room 136	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-												
44963	IE Weldon Secondary School	1	152	Room 136	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44964	IE Weldon Secondary School	1	152	Room 136	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44965	IE Weldon Secondary School	1	152	Room 136	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44953	IE Weldon Secondary School	1	153	Room 132	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-												
44954	IE Weldon Secondary School	1	153	Room 132	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44955	IE Weldon Secondary School	1	153	Room 132	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44956	IE Weldon Secondary School	1	153	Room 132	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44941	IE Weldon Secondary School	1	154	Room 128	No	No	FL	VFT	1	N/D	-	-	40-B5-05C			-												
44942	IE Weldon Secondary School	1	154	Room 128	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44943	IE Weldon Secondary School	1	154	Room 128	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44944	IE Weldon Secondary School	1	154	Room 128	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44936	IE Weldon Secondary School	1	155	Room 127	No	No	FL	VFT	4	N/D	-	-	40-B5--09A,B,C			-			vft-4 was not observed during this reassessment									
44937	IE Weldon Secondary School	1	155	Room 127	No	No	FL	VFT	1	N/D	-	-	40-B5-05			-												
44938	IE Weldon Secondary School	1	155	Room 127	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44939	IE Weldon Secondary School	1	155	Room 127	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44940	IE Weldon Secondary School	1	155	Room 127	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44932	IE Weldon Secondary School	1	156	Room 126	No	No	FL	VFT	5	N/D	-	-	40-B5-10A			-												
44933	IE Weldon Secondary School	1	156	Room 126	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
44934	IE Weldon Secondary School	1	156	Room 126	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44935	IE Weldon Secondary School	1	156	Room 126	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45211	IE Weldon Secondary School	1	157	Hallway H9	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45221	IE Weldon Secondary School	1	157	Hallway H9	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45230	IE Weldon Secondary School	1	157	Hallway H9	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Capostite PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking										
					CONDITION G: Good F: Fair P: Poor														
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45233	IE Weldon Secondary School	1	158	Entrance E2	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45234	IE Weldon Secondary School	1	158	Entrance E2	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45235	IE Weldon Secondary School	1	158	Entrance E2	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44772	IE Weldon Secondary School	1	158A	Stairs 1	No	Yes	WL	TF		N/D	-	-	40-B5-01D			-			
44773	IE Weldon Secondary School	1	158A	Stairs 1	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44774	IE Weldon Secondary School	1	158A	Stairs 1	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44929	IE Weldon Secondary School	1	159	Room 123	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-			
44930	IE Weldon Secondary School	1	159	Room 123	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44931	IE Weldon Secondary School	1	159	Room 123	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44926	IE Weldon Secondary School	1	160	Room 121	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-			
44927	IE Weldon Secondary School	1	160	Room 121	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44928	IE Weldon Secondary School	1	160	Room 121	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44915	IE Weldon Secondary School	1	161	Room 119	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-			
44916	IE Weldon Secondary School	1	161	Room 119	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44917	IE Weldon Secondary School	1	161	Room 119	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
45196	IE Weldon Secondary School	1	162	Room 198 (Storage)	No	No	FL	VFT	5	N/D	-	-	V/C:40-B5-10			-			
45197	IE Weldon Secondary School	1	162	Room 198 (Storage)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45198	IE Weldon Secondary School	1	162	Room 198 (Storage)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44889	IE Weldon Secondary School	1	164	Room 114 (Staff Room)	No	No	FL	VFT	1	N/D	-	-	40-B5-05B			-			
44890	IE Weldon Secondary School	1	164	Room 114 (Staff Room)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44891	IE Weldon Secondary School	1	164	Room 114 (Staff Room)	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44892	IE Weldon Secondary School	1	164	Room 114 (Staff Room)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44895	IE Weldon Secondary School	1	165	Room 116 (Backstage)	No	No	FL	VFT	5	N/D	-	-	V/C:40-B5-10			-			
44896	IE Weldon Secondary School	1	165	Room 116 (Backstage)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44897	IE Weldon Secondary School	1	165	Room 116 (Backstage)	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44898	IE Weldon Secondary School	1	165	Room 116 (Backstage)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
45181	IE Weldon Secondary School	1	165A	Room 193 A	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-			
45182	IE Weldon Secondary School	1	165A	Room 193 A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45183	IE Weldon Secondary School	1	165A	Room 193 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44893	IE Weldon Secondary School	1	166	Room 115 (Stage)	No	No	FL	VFT	12	N/D	-	-	V/C:40-B5-18			-			
44894	IE Weldon Secondary School	1	166	Room 115 (Stage)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44886	IE Weldon Secondary School	1	167	Room 113 Cafeteria	No	No	FL	VFT	14	N/D	-	-	40-B5-20A,B,C			-			
44887	IE Weldon Secondary School	1	167	Room 113 Cafeteria	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44888	IE Weldon Secondary School	1	167	Room 113 Cafeteria	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44907	IE Weldon Secondary School	1	168	Room 117 C	No	No	FL	VSF	2	N/D	-	-	40-B5-04A			-			
44908	IE Weldon Secondary School	1	168	Room 117 C	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03B			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44909	IE Weldon Secondary School	1	168	Room 117 C	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44910	IE Weldon Secondary School	1	168	Room 117 C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
44903	IE Weldon Secondary School	1	168A	Room 117 B	No	No	FL	VSF	2	N/D	-	-	40-B5-04C			-			
44904	IE Weldon Secondary School	1	168A	Room 117 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile
44905	IE Weldon Secondary School	1	168A	Room 117 B	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-			
44906	IE Weldon Secondary School	1	168A	Room 117 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
45199	IE Weldon Secondary School	1	169	Room 199	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45200	IE Weldon Secondary School	1	169	Room 199	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			
45201	IE Weldon Secondary School	1	170	Room 199 A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile
45202	IE Weldon Secondary School	1	170	Room 199 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-			


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck				ACCESSIBILITY B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposte				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes									
44899	IE Weldon Secondary School	1	171	Room 117 A	No	No	FL	VSF	2	N/D	-	-	40-B5-04C		-													
44900	IE Weldon Secondary School	1	171	Room 117 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44901	IE Weldon Secondary School	1	171	Room 117 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44902	IE Weldon Secondary School	1	171	Room 117 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44878	IE Weldon Secondary School	1	172	Room 112	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-													
44879	IE Weldon Secondary School	1	172	Room 112	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44880	IE Weldon Secondary School	1	172	Room 112	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44881	IE Weldon Secondary School	1	172	Room 112	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44882	IE Weldon Secondary School	1	172A	Room 112A	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-													
44883	IE Weldon Secondary School	1	172A	Room 112A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44884	IE Weldon Secondary School	1	172A	Room 112A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44885	IE Weldon Secondary School	1	172A	Room 112A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44875	IE Weldon Secondary School	1	173	Room 111 (Storage)	No	No	FL	VFT	5	N/D	-	-	V/C:40-B5-10		-													
44876	IE Weldon Secondary School	1	173	Room 111 (Storage)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44877	IE Weldon Secondary School	1	173	Room 111 (Storage)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44855	IE Weldon Secondary School	1	174	Room 109	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-													
44856	IE Weldon Secondary School	1	174	Room 109	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44857	IE Weldon Secondary School	1	174	Room 109	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44858	IE Weldon Secondary School	1	174	Room 109	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44859	IE Weldon Secondary School	1	174A	Room 109 A	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-													
44860	IE Weldon Secondary School	1	174A	Room 109 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44861	IE Weldon Secondary School	1	174A	Room 109 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44862	IE Weldon Secondary School	1	174A	Room 109 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44863	IE Weldon Secondary School	1	174B	Room 109 B	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-													
44864	IE Weldon Secondary School	1	174B	Room 109 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44865	IE Weldon Secondary School	1	174B	Room 109 B	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44866	IE Weldon Secondary School	1	174B	Room 109 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44867	IE Weldon Secondary School	1	174C	Room 109 C	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-													
44868	IE Weldon Secondary School	1	174C	Room 109 C	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44869	IE Weldon Secondary School	1	174C	Room 109 C	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44870	IE Weldon Secondary School	1	174C	Room 109 C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44871	IE Weldon Secondary School	1	174D	Room 109 D	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-													
44872	IE Weldon Secondary School	1	174D	Room 109 D	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
44873	IE Weldon Secondary School	1	174D	Room 109 D	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
44874	IE Weldon Secondary School	1	174D	Room 109 D	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													
44966	IE Weldon Secondary School	1	175	Room 137	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed									
44967	IE Weldon Secondary School	1	175A	Room 137 (Gym Storage)	-	-	-	-	-	-	-	-	-		-				ACM and/orPACM not observed									
45213	IE Weldon Secondary School	1	176	Hallway H11	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75% 1% Chrysotile									
45223	IE Weldon Secondary School	1	176	Hallway H11	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-													
45232	IE Weldon Secondary School	1	176	Hallway H11	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-													


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes									
44984	IE Weldon Secondary School	1	177	Room 145 (Library)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44985	IE Weldon Secondary School	1	177	Room 145 (Library)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44986	IE Weldon Secondary School	1	177	Room 145 (Library)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44987	IE Weldon Secondary School	1	177A	Room 145 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44988	IE Weldon Secondary School	1	177A	Room 145 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44989	IE Weldon Secondary School	1	177A	Room 145 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44990	IE Weldon Secondary School	1	177B	Room 145 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44991	IE Weldon Secondary School	1	177B	Room 145 B	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44992	IE Weldon Secondary School	1	177B	Room 145 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44980	IE Weldon Secondary School	1	178	Room 143	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-												
44981	IE Weldon Secondary School	1	178	Room 143	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44982	IE Weldon Secondary School	1	178	Room 143	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44983	IE Weldon Secondary School	1	178	Room 143	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44976	IE Weldon Secondary School	1	179	Room 142	Yes	No	FL	VFT	11	2% Chrysotile	400 SF	G	40-B5-17C			A												
44977	IE Weldon Secondary School	1	179	Room 142	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44978	IE Weldon Secondary School	1	179	Room 142	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44979	IE Weldon Secondary School	1	179	Room 142	No	Yes	ST	SFP		N/D	-	-	40-B5-21F			-												
44972	IE Weldon Secondary School	1	180	Room 141	No	No	FL	VFT	11	2% Chrysotile			V/C:40-B5-17			-			Removed Summer 2015.									
44973	IE Weldon Secondary School	1	180	Room 141	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44974	IE Weldon Secondary School	1	180	Room 141	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44975	IE Weldon Secondary School	1	180	Room 141	No	Yes	ST	SFP		N/D	-	-	40-B5-21E			-												
44911	IE Weldon Secondary School	1	181	Room 118 (I B Coordinator)	No	No	FL	VFT	2	N/D	-	-	40-B5-06A			-												
44912	IE Weldon Secondary School	1	181	Room 118 (I B Coordinator)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03B			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44913	IE Weldon Secondary School	1	181	Room 118 (I B Coordinator)	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44914	IE Weldon Secondary School	1	181	Room 118 (I B Coordinator)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44918	IE Weldon Secondary School	1	182	Room 120 (Business EC)	No	No	FL	VFT	2	N/D	-	-	40-B5-06C			-												
44919	IE Weldon Secondary School	1	182	Room 120 (Business EC)	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A												
44920	IE Weldon Secondary School	1	182	Room 120 (Business EC)	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44921	IE Weldon Secondary School	1	182	Room 120 (Business EC)	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44922	IE Weldon Secondary School	1	182A	Room 120 A	No	No	FL	VFT	2	N/D	-	-	40-B5-06B			-												
44923	IE Weldon Secondary School	1	182A	Room 120 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44924	IE Weldon Secondary School	1	182A	Room 120 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44925	IE Weldon Secondary School	1	182A	Room 120 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44945	IE Weldon Secondary School	1	183	Room 129	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-												
44946	IE Weldon Secondary School	1	183	Room 129	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44947	IE Weldon Secondary School	1	183	Room 129	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44948	IE Weldon Secondary School	1	183	Room 129	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44949	IE Weldon Secondary School	1	184	Room 130	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-												
44950	IE Weldon Secondary School	1	184	Room 130	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44951	IE Weldon Secondary School	1	184	Room 130	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44952	IE Weldon Secondary School	1	184	Room 130	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
44957	IE Weldon Secondary School	1	185	Room 134	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-												
44958	IE Weldon Secondary School	1	185	Room 134	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E & F confirmed to contain 0.75%-1% Chrysotile									
44959	IE Weldon Secondary School	1	185	Room 134	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
44960	IE Weldon Secondary School	1	185	Room 134	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
ID	Facility	Floor #	Room #	Room name	Has ACM	Frivable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes									
45128	IE Weldon Secondary School	1	186	Room 184	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45129	IE Weldon Secondary School	1	186	Room 184	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45130	IE Weldon Secondary School	1	186	Room 184	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45119	IE Weldon Secondary School	1	187	Room 181	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45120	IE Weldon Secondary School	1	187	Room 181	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45121	IE Weldon Secondary School	1	187	Room 181	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45122	IE Weldon Secondary School	1	187	Room 181	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45107	IE Weldon Secondary School	1	188	Room 180	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45108	IE Weldon Secondary School	1	188	Room 180	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45109	IE Weldon Secondary School	1	188	Room 180	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45110	IE Weldon Secondary School	1	188A	Room 180 A	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45111	IE Weldon Secondary School	1	188A	Room 180 A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45112	IE Weldon Secondary School	1	188A	Room 180 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45113	IE Weldon Secondary School	1	188B	Room 180 B	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45114	IE Weldon Secondary School	1	188B	Room 180 B	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45115	IE Weldon Secondary School	1	188B	Room 180 B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45116	IE Weldon Secondary School	1	188C	Room 180 C	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45117	IE Weldon Secondary School	1	188C	Room 180 C	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45118	IE Weldon Secondary School	1	188C	Room 180 C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45104	IE Weldon Secondary School	1	189	Room 179	No	No	FL	VFT	8	N/D	-	-	40-B5-13A,B,C			-												
45105	IE Weldon Secondary School	1	189	Room 179	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45106	IE Weldon Secondary School	1	189	Room 179	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45097	IE Weldon Secondary School	1	190	Room 175	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45098	IE Weldon Secondary School	1	190	Room 175	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45099	IE Weldon Secondary School	1	190	Room 175	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45082	IE Weldon Secondary School	1	191	Room 173B	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45085	IE Weldon Secondary School	1	191	Room 173B	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45088	IE Weldon Secondary School	1	191	Room 173B	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45080	IE Weldon Secondary School	1	191A	Room 173A	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45083	IE Weldon Secondary School	1	191A	Room 173A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45086	IE Weldon Secondary School	1	191A	Room 173A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45081	IE Weldon Secondary School	1	191B	Room 173C	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-												
45084	IE Weldon Secondary School	1	191B	Room 173C	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45087	IE Weldon Secondary School	1	191B	Room 173C	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												
45067	IE Weldon Secondary School	1	192	Room 171	No	No	FL	VFT		2% Chrysotile	-	-	18778-S01A			-				Removed summer 2020								
	IE Weldon Secondary School	1	192	Room 171	Yes	No	FL	MA		2% Chrysotile	900 SF	G	18778-S01A			E				Black mastic								
45068	IE Weldon Secondary School	1	192	Room 171	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A				Samples E& F confirmed to contain 0.75%-1% Chrysotile								
45069	IE Weldon Secondary School	1	192	Room 171	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45070	IE Weldon Secondary School	1	192	Room 171	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21			-												


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
					CONDITION G: Good F: Fair P: Poor																			
ID	Facility	Floor #	Room #	Room name	Has ACM	Frilable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes					
45056	IE Weldon Secondary School	1	193	Room 169	No	No	FL	VFT	13	N/D	-	-	40-B5-19A			-								
45057	IE Weldon Secondary School	1	193	Room 169	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03F		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45058	IE Weldon Secondary School	1	193	Room 169	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45059	IE Weldon Secondary School	1	193	Room 169	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-									
45060	IE Weldon Secondary School	1	193A	Room 169 A	No	No	FL	VFT	13	N/D	-	-	40-B5-19B,C		-									
45061	IE Weldon Secondary School	1	193A	Room 169 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03F		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45062	IE Weldon Secondary School	1	193A	Room 169 A	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45063	IE Weldon Secondary School	1	193A	Room 169 A	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-									
45028	IE Weldon Secondary School	1	194	Room 156	No	No	FL	VFT	3	N/D	-	-	40-B5-08A,B,C		-									
45029	IE Weldon Secondary School	1	194	Room 156	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03F		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45030	IE Weldon Secondary School	1	194	Room 156	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45031	IE Weldon Secondary School	1	194	Room 156	No	Yes	ST	SFP		N/D	-	-	V/C:40-B5-21		-									
45016	IE Weldon Secondary School	1	195	Room 155	No	No	FL	VFT	13	N/D	-	-	40-B5-19 B,C		-									
45017	IE Weldon Secondary School	1	195	Room 155	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45018	IE Weldon Secondary School	1	195	Room 155	No	No	CL	CT	1	N/D	-	-	40-B5-07A		-									
45019	IE Weldon Secondary School	1	195	Room 155	No	Yes	ST	SFP		N/D	-	-	40-B5-21B,D		-									
45020	IE Weldon Secondary School	1	195A	Room 155 A	No	No	FL	VFT	13	N/D	-	-	40-B5-19 B,C		-									
45021	IE Weldon Secondary School	1	195A	Room 155 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45022	IE Weldon Secondary School	1	195A	Room 155 A	No	No	CL	CT	1	N/D	-	-	40-B5-07A		-									
45023	IE Weldon Secondary School	1	195A	Room 155 A	No	Yes	ST	SFP		N/D	-	-	40-B5-21B,D		-									
45024	IE Weldon Secondary School	1	195B	Room 155 B	No	No	FL	VFT	6	N/D	-	-	40-B5-11 B		-									
45025	IE Weldon Secondary School	1	195B	Room 155 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45026	IE Weldon Secondary School	1	195B	Room 155 B	No	No	CL	CT	1	N/D	-	-	40-B5-07A		-									
45027	IE Weldon Secondary School	1	195B	Room 155 B	No	Yes	ST	SFP		N/D	-	-	40-B5-21B,D		-									
45455	IE Weldon Secondary School	2	201	Stair 1	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45456	IE Weldon Secondary School	2	201	Stair 1	No	No	WL	TF	2	N/D	-	-	V/C:40-B5-01		-									
45457	IE Weldon Secondary School	2	201	Stair 1	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45458	IE Weldon Secondary School	2	201	Stair 1	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45480	IE Weldon Secondary School	2	202	Hallway H20	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45489	IE Weldon Secondary School	2	202	Hallway H20	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45498	IE Weldon Secondary School	2	202	Hallway H20	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45253	IE Weldon Secondary School	2	203	Room 211	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-									
45254	IE Weldon Secondary School	2	203	Room 211	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45255	IE Weldon Secondary School	2	203	Room 211	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-									
45256	IE Weldon Secondary School	2	203	Room 211	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45252	IE Weldon Secondary School	2	204	Room 209	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45251	IE Weldon Secondary School	2	205	Room 208	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45249	IE Weldon Secondary School	2	206	Room 207	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45250	IE Weldon Secondary School	2	206	Room 207	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45247	IE Weldon Secondary School	2	207	Room 206	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45248	IE Weldon Secondary School	2	207	Room 206	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									
45244	IE Weldon Secondary School	2	208	Room 205 (Custodial Storage)	No	No	FL	VFT	5	N/D	-	-	V/C:40-B5-10		-									
45245	IE Weldon Secondary School	2	208	Room 205 (Custodial Storage)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile					
45246	IE Weldon Secondary School	2	208	Room 205 (Custodial Storage)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-									


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

		STRUCTURAL ELEMENT			ACCESSIBILITY				TERMINOLOGY																						
		RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck			B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical			A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes												
45240	IE Weldon Secondary School	2	209	Room 204	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11			-															
45241	IE Weldon Secondary School	2	209	Room 204	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45242	IE Weldon Secondary School	2	209	Room 204	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-																
45243	IE Weldon Secondary School	2	209	Room 204	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45238	IE Weldon Secondary School	2	210	Room 203 (Staff Women WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45239	IE Weldon Secondary School	2	210	Room 203 (Staff Women WR)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45236	IE Weldon Secondary School	2	211	Room 202 (Staff Men WR)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45237	IE Weldon Secondary School	2	211	Room 202 (Staff Men WR)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45479	IE Weldon Secondary School	2	212	Hallway H19	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45488	IE Weldon Secondary School	2	212	Hallway H19	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-																
45497	IE Weldon Secondary School	2	212	Hallway H19	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45459	IE Weldon Secondary School	2	213	Stair 2	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45460	IE Weldon Secondary School	2	213	Stair 2	No	No	WL	TF	2	N/D	-	-	40-B5-01 A,B		-																
45461	IE Weldon Secondary School	2	213	Stair 2	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-																
45462	IE Weldon Secondary School	2	213	Stair 2	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45478	IE Weldon Secondary School	2	214	Hallway H18	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45487	IE Weldon Secondary School	2	214	Hallway H18	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-																
45496	IE Weldon Secondary School	2	214	Hallway H18	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45451	IE Weldon Secondary School	2	215	Location 270	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-																
45452	IE Weldon Secondary School	2	215	Location 270	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45453	IE Weldon Secondary School	2	215	Location 270	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45454	IE Weldon Secondary School	2	215	Location 270	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45447	IE Weldon Secondary School	2	216	Location 269	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-																
45448	IE Weldon Secondary School	2	216	Location 269	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45449	IE Weldon Secondary School	2	216	Location 269	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45450	IE Weldon Secondary School	2	216	Location 269	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45444	IE Weldon Secondary School	2	217	Location 268	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45445	IE Weldon Secondary School	2	217	Location 268	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45446	IE Weldon Secondary School	2	217	Location 268	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45477	IE Weldon Secondary School	2	218	Hallway H17	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45486	IE Weldon Secondary School	2	218	Hallway H17	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-																
45495	IE Weldon Secondary School	2	218	Hallway H17	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45441	IE Weldon Secondary School	2	219	Room 267	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45442	IE Weldon Secondary School	2	219	Room 267	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45443	IE Weldon Secondary School	2	219	Room 267	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45438	IE Weldon Secondary School	2	220	Room 264	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45439	IE Weldon Secondary School	2	220	Room 264	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45440	IE Weldon Secondary School	2	220	Room 264	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45432	IE Weldon Secondary School	2	221	Room 263 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45433	IE Weldon Secondary School	2	221	Room 263 A	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45434	IE Weldon Secondary School	2	221	Room 263 A	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45435	IE Weldon Secondary School	2	221A	Room 263 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45436	IE Weldon Secondary School	2	221A	Room 263 B	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45437	IE Weldon Secondary School	2	221A	Room 263 B	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45429	IE Weldon Secondary School	2	221B	Room 263	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45430	IE Weldon Secondary School	2	221B	Room 263	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																
45431	IE Weldon Secondary School	2	221B	Room 263	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-																
45422	IE Weldon Secondary School	2	222	Room 261	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile												
45423	IE Weldon Secondary School	2	222	Room 261	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-																


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof B/J: Beams/Joists WN: Window CB: Chalkboard FL: Floor PI: Pipe CL: Ceiling DT: Duct WL: Wall BL: Boiler DK: Deck MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish		TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile		VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
	ID	Facility	Floor #	Room #	Room name	Has ACM	Frivable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45424	IE Weldon Secondary School	2	222	Room 261	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-				
45419	IE Weldon Secondary School	2	223	Room 260	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	40-B5-03A		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45420	IE Weldon Secondary School	2	223	Room 260	No	No	CL	CT	2	N/D	-	-	V/C: 40-B5-16		-					
45421	IE Weldon Secondary School	2	223	Room 260	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45476	IE Weldon Secondary School	2	224	Hallway H16	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45485	IE Weldon Secondary School	2	224	Hallway H16	No	No	CL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45494	IE Weldon Secondary School	2	224	Hallway H16	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45418	IE Weldon Secondary School	2	225	Room 259 (Electrical Room)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45463	IE Weldon Secondary School	2	226	Stair 3	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45464	IE Weldon Secondary School	2	226	Stair 3	No	No	CL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45465	IE Weldon Secondary School	2	226	Stair 3	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45410	IE Weldon Secondary School	2	227	Room 257	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45411	IE Weldon Secondary School	2	227	Room 257	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45412	IE Weldon Secondary School	2	227	Room 257	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45413	IE Weldon Secondary School	2	227	Room 257	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45397	IE Weldon Secondary School	2	228	Room 254	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45398	IE Weldon Secondary School	2	228	Room 254	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45399	IE Weldon Secondary School	2	228	Room 254	No	No	CL	CT	2	N/D	-	-	V/C: 40-B5-16		-					
45400	IE Weldon Secondary School	2	228	Room 254	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45396	IE Weldon Secondary School	2	229	Room 253 (Mechanical Room)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45391	IE Weldon Secondary School	2	230	Room 251	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45392	IE Weldon Secondary School	2	230	Room 251	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45389	IE Weldon Secondary School	2	231	Room 250	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		C				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45390	IE Weldon Secondary School	2	231	Room 250	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45369	IE Weldon Secondary School	2	232	Room 247	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45370	IE Weldon Secondary School	2	232	Room 247	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45371	IE Weldon Secondary School	2	232	Room 247	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45372	IE Weldon Secondary School	2	232	Room 247	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45373	IE Weldon Secondary School	2	232A	Room 247 A	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45374	IE Weldon Secondary School	2	232A	Room 247 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45375	IE Weldon Secondary School	2	232A	Room 247 A	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45376	IE Weldon Secondary School	2	232A	Room 247 A	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45377	IE Weldon Secondary School	2	232B	Room 247 B	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45378	IE Weldon Secondary School	2	232B	Room 247 B	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45379	IE Weldon Secondary School	2	232B	Room 247 B	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45380	IE Weldon Secondary School	2	232B	Room 247 B	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45385	IE Weldon Secondary School	2	232C	Room 249	No	No	FL	VFT	1	N/D	-	-	V/C: 40-B5-05		-					
45386	IE Weldon Secondary School	2	232C	Room 249	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45387	IE Weldon Secondary School	2	232C	Room 249	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45388	IE Weldon Secondary School	2	232C	Room 249	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45365	IE Weldon Secondary School	2	233	Room 246	No	No	FL	VFT	6	N/D	-	-	V/C: 40-B5-11		-					
45366	IE Weldon Secondary School	2	233	Room 246	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45367	IE Weldon Secondary School	2	233	Room 246	No	No	FL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45368	IE Weldon Secondary School	2	233	Room 246	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					
45466	IE Weldon Secondary School	2	234	Stair 4	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C: 40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile	
45467	IE Weldon Secondary School	2	234	Stair 4	No	No	WL	TF	2	N/D	-	-	40-B5-01 E		-					
45468	IE Weldon Secondary School	2	234	Stair 4	No	No	CL	CT	1	N/D	-	-	V/C: 40-B5-07		-					
45469	IE Weldon Secondary School	2	234	Stair 4	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-					


APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck				ACCESSIBILITY B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic CONDITION G: Good F: Fair P: Poor				N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite				PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish				TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile				VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking			
ID	Facility	Floor #	Room #	Room name	Has ACM	Friable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes									
45343	IE Weldon Secondary School	2	235	Room 235 (Janitor Room)	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45344	IE Weldon Secondary School	2	235	Room 235 (Janitor Room)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45474	IE Weldon Secondary School	2	236	Hallway- H14	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45483	IE Weldon Secondary School	2	236	Hallway- H14	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45492	IE Weldon Secondary School	2	236	Hallway- H14	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45475	IE Weldon Secondary School	2	238	Hallway- H15	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45484	IE Weldon Secondary School	2	238	Hallway- H15	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45493	IE Weldon Secondary School	2	238	Hallway- H15	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45312	IE Weldon Secondary School	2	239	Room 226	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45313	IE Weldon Secondary School	2	239	Room 226	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45314	IE Weldon Secondary School	2	239	Room 226	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45315	IE Weldon Secondary School	2	239	Room 226	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45320	IE Weldon Secondary School	2	240	Room 228	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45321	IE Weldon Secondary School	2	240	Room 228	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45322	IE Weldon Secondary School	2	241	Room 229	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			C			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45323	IE Weldon Secondary School	2	241	Room 229	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45324	IE Weldon Secondary School	2	242	Room 230	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45325	IE Weldon Secondary School	2	242	Room 230	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45326	IE Weldon Secondary School	2	242	Room 230	No	No	FL	CT	2	N/D	-	-	V/C:40-B5-16			-												
45327	IE Weldon Secondary School	2	242	Room 230	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45331	IE Weldon Secondary School	2	243	Room 232	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45332	IE Weldon Secondary School	2	243	Room 232	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45333	IE Weldon Secondary School	2	243	Room 232	No	No	FL	CT	2	N/D	-	-	V/C:40-B5-16			-												
45334	IE Weldon Secondary School	2	243	Room 232	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45339	IE Weldon Secondary School	2	244	Room 234	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45340	IE Weldon Secondary School	2	244	Room 234	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45341	IE Weldon Secondary School	2	244	Room 234	No	No	FL	CT	2	N/D	-	-	V/C:40-B5-16			-												
45342	IE Weldon Secondary School	2	244	Room 234	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45470	IE Weldon Secondary School	2	245	Stair 5	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45471	IE Weldon Secondary School	2	245	Stair 5	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45472	IE Weldon Secondary School	2	245	Stair 5	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45335	IE Weldon Secondary School	2	246	Room 233	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45336	IE Weldon Secondary School	2	246	Room 233	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45337	IE Weldon Secondary School	2	246	Room 233	No	No	FL	CT	2	N/D	-	-	V/C:40-B5-16			-												
45338	IE Weldon Secondary School	2	246	Room 233	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45328	IE Weldon Secondary School	2	247	Room 231	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45329	IE Weldon Secondary School	2	247	Room 231	No	No	FL	CT	2	N/D	-	-	V/C:40-B5-16			-												
45330	IE Weldon Secondary School	2	247	Room 231	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45503	IE Weldon Secondary School	2	247	Room 231	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A												
45316	IE Weldon Secondary School	2	248	Room 227	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45317	IE Weldon Secondary School	2	248	Room 227	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45318	IE Weldon Secondary School	2	248	Room 227	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45319	IE Weldon Secondary School	2	248	Room 227	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45308	IE Weldon Secondary School	2	249	Room 225	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45309	IE Weldon Secondary School	2	249	Room 225	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45310	IE Weldon Secondary School	2	249	Room 225	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45311	IE Weldon Secondary School	2	249	Room 225	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												
45304	IE Weldon Secondary School	2	250	Room 224	No	No	FL	VFT	2	N/D	-	-	V/C:40-B5-06			-												
45305	IE Weldon Secondary School	2	250	Room 224	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03			A			Samples E& F confirmed to contain 0.75%-1% Chrysotile									
45306	IE Weldon Secondary School	2	250	Room 224	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07			-												
45307	IE Weldon Secondary School	2	250	Room 224	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21			-												

APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Caposite PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile VSC: Vinyl Sheet Flooring VIC: Visually Consistent w/ Other Sampled Material WC: Window Caulking										
					CONDITION G: Good F: Fair P: Poor														
ID	Facility	Floor #	Room #	Room name	Has ACM	Frable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45300	IE Weldon Secondary School	2	251	Room 223	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05			-			
45301	IE Weldon Secondary School	2	251	Room 223	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45302	IE Weldon Secondary School	2	251	Room 223	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45303	IE Weldon Secondary School	2	251	Room 223	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45473	IE Weldon Secondary School	2	252	Hallway H13	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45482	IE Weldon Secondary School	2	252	Hallway H13	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45491	IE Weldon Secondary School	2	252	Hallway H13	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45292	IE Weldon Secondary School	2	253	Room 221	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45293	IE Weldon Secondary School	2	253	Room 221	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45294	IE Weldon Secondary School	2	253	Room 221	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45295	IE Weldon Secondary School	2	253	Room 221	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45284	IE Weldon Secondary School	2	254	Room 219	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45285	IE Weldon Secondary School	2	254	Room 219	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45286	IE Weldon Secondary School	2	254	Room 219	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45287	IE Weldon Secondary School	2	254	Room 219	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45280	IE Weldon Secondary School	2	255	Room 218	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45281	IE Weldon Secondary School	2	255	Room 218	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45282	IE Weldon Secondary School	2	255	Room 218	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45283	IE Weldon Secondary School	2	255	Room 218	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45268	IE Weldon Secondary School	2	256	Room 214	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45269	IE Weldon Secondary School	2	256	Room 214	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45270	IE Weldon Secondary School	2	256	Room 214	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45271	IE Weldon Secondary School	2	256	Room 214	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45257	IE Weldon Secondary School	2	257	Room 212	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45258	IE Weldon Secondary School	2	257	Room 212	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45259	IE Weldon Secondary School	2	257	Room 212	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45260	IE Weldon Secondary School	2	257	Room 212	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45261	IE Weldon Secondary School	2	258	Room 212 A	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45262	IE Weldon Secondary School	2	258	Room 212 A	Yes	No	CL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		C				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45263	IE Weldon Secondary School	2	258	Room 212 A	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45264	IE Weldon Secondary School	2	259	Room 213	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45265	IE Weldon Secondary School	2	259	Room 213	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45266	IE Weldon Secondary School	2	259	Room 213	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45267	IE Weldon Secondary School	2	259	Room 213	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45272	IE Weldon Secondary School	2	260	Room 215	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45273	IE Weldon Secondary School	2	260	Room 215	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45274	IE Weldon Secondary School	2	260	Room 215	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45275	IE Weldon Secondary School	2	260	Room 215	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45276	IE Weldon Secondary School	2	261	Room 217	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45277	IE Weldon Secondary School	2	261	Room 217	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45278	IE Weldon Secondary School	2	261	Room 217	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45279	IE Weldon Secondary School	2	261	Room 217	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45288	IE Weldon Secondary School	2	262	Room 220	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45289	IE Weldon Secondary School	2	262	Room 220	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45290	IE Weldon Secondary School	2	262	Room 220	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45291	IE Weldon Secondary School	2	262	Room 220	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45296	IE Weldon Secondary School	2	263	Room 222	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45297	IE Weldon Secondary School	2	263	Room 222	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E& F confirmed to contain 0.75%-1% Chrysotile
45298	IE Weldon Secondary School	2	263	Room 222	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45299	IE Weldon Secondary School	2	263	Room 222	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				

APPENDIX I - ROOM BY ROOM ASBESTOS INVENTORY

	STRUCTURAL ELEMENT RF: Roof WN: Window FL: Floor CL: Ceiling WL: Wall DK: Deck B/J: Beams/Joists CB: Chalkboard PI: Pipe DT: Duct BL: Boiler MC: Mechanical				ACCESSIBILITY A: All occupants of the facility B: Maintenance staff without a ladder C: Maintenance staff with a ladder, exposed to view without moving building components D: Maintenance staff with a ladder, concealed from view by building components E: No access without demolition or removal of fixed building components or systems				TERMINOLOGY ACM: Asbestos Containing Material CT: Ceiling Tile DJC: Drywall Joint Compound FTG: Fitting LF: Linear Feet MA: Mastic N/A: Not Applicable N/Anz: Not Analyzed N/D: None Detected PI-AC: Pipe Insulation - Aircell PI-PC: Pipe Insulation-Parging Cement PI-CP: Pipe Insulation-Capostite PL: Plaster RM: Roofing Materials SFP: Sprayed Fireproofing SF: Square Feet TF: Texture Finish TB: Transite Board TP: Transite Pipe VI: Vermiculite Insulation VFT: Vinyl Floor Tile VSF: Vinyl Sheet Flooring V/C: Visually Consistent w/ Other Sampled Material WC: Window Caulking										
					CONDITION G: Good F: Fair P: Poor														
ID	Facility	Floor #	Room #	Room name	Has ACM	Frivable	Struct. Elem.	Application	Material	Type	Qty	Condition	Sample #	Action	Ref #	Comments 1	Comments 2	Comments 3	Notes
45361	IE Weldon Secondary School	2	264	Room 245	No	No	FL	VFT	8	N/D	-	-	V/C:40-B5-13			-			
45362	IE Weldon Secondary School	2	264	Room 245	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45363	IE Weldon Secondary School	2	264	Room 245	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45364	IE Weldon Secondary School	2	264	Room 245	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45357	IE Weldon Secondary School	2	265	Room 244	No	No	FL	VFT	11	2% Chrysotile			V/C:40-B5-17						Removed
45358	IE Weldon Secondary School	2	265	Room 244	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45359	IE Weldon Secondary School	2	265	Room 244	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45360	IE Weldon Secondary School	2	265	Room 244	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45353	IE Weldon Secondary School	2	266	Room 243	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45354	IE Weldon Secondary School	2	266	Room 243	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45355	IE Weldon Secondary School	2	266	Room 243	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45356	IE Weldon Secondary School	2	266	Room 243	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45349	IE Weldon Secondary School	2	267	Room 242	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45350	IE Weldon Secondary School	2	267	Room 242	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45351	IE Weldon Secondary School	2	267	Room 242	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45352	IE Weldon Secondary School	2	267	Room 242	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45345	IE Weldon Secondary School	2	268	Room 241	No	No	FL	VFT	1	N/D	-	-	V/C:40-B5-05		-				
45346	IE Weldon Secondary School	2	268	Room 241	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45347	IE Weldon Secondary School	2	268	Room 241	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45348	IE Weldon Secondary School	2	268	Room 241	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45481	IE Weldon Secondary School	2	269	Hallway H21	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45490	IE Weldon Secondary School	2	269	Hallway H21	No	No	CL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45499	IE Weldon Secondary School	2	269	Hallway H21	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45381	IE Weldon Secondary School	2	270	Room 248	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45382	IE Weldon Secondary School	2	270	Room 248	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45383	IE Weldon Secondary School	2	270	Room 248	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45384	IE Weldon Secondary School	2	270	Room 248	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45393	IE Weldon Secondary School	2	271	Room 252	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45394	IE Weldon Secondary School	2	271	Room 252	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-				
45395	IE Weldon Secondary School	2	271	Room 252	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45401	IE Weldon Secondary School	2	272	Room 255 (Mechanical Room)	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45402	IE Weldon Secondary School	2	273	Room 256	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45403	IE Weldon Secondary School	2	273	Room 256	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45404	IE Weldon Secondary School	2	273	Room 256	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45405	IE Weldon Secondary School	2	273	Room 256	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45406	IE Weldon Secondary School	2	273A	Room 256 A	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45407	IE Weldon Secondary School	2	273A	Room 256 A	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45408	IE Weldon Secondary School	2	273A	Room 256 A	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45409	IE Weldon Secondary School	2	273A	Room 256 A	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45414	IE Weldon Secondary School	2	274	Room 258	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45415	IE Weldon Secondary School	2	274	Room 258	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45416	IE Weldon Secondary School	2	274	Room 258	No	No	FL	CT	1	N/D	-	-	V/C:40-B5-07		-				
45417	IE Weldon Secondary School	2	274	Room 258	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
45425	IE Weldon Secondary School	2	274A	Room 262	No	No	FL	VFT	6	N/D	-	-	V/C:40-B5-11		-				
45426	IE Weldon Secondary School	2	274A	Room 262	Yes	No	WL	DJC		0.75% -1% Chrysotile	1	G	V/C:40-B5-03		A				Samples E & F confirmed to contain 0.75%-1% Chrysotile
45427	IE Weldon Secondary School	2	274A	Room 262	No	No	CL	CT	2	N/D	-	-	V/C:40-B5-16		-				
45428	IE Weldon Secondary School	2	274A	Room 262	No	No	ST	SFP		N/D	-	-	V/C: 40-B5-21		-				
44764	IE Weldon Secondary School	NA		EXTERIOR	Suspect	No	WN	TB	N/A	ACM ASSUMED	1	G	NS		A, C				sample prior to renovation

APPENDIX II

DRAWINGS

Please Note:
Drywall Joint Compound (DJC) has been identified as ASBESTOS CONTAINING throughout the building.

Asbestos-containing transite board (TB) is suspected to be present on the building exterior.

Black mastic (MA) associated with vinyl floor tiles has been identified as ASBESTOS CONTAINING throughout the building.

LEGEND

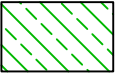

- 12578-48-01A

ECOH Sample Locations
- 01-BS-01A

Jacques Whitford Sample Locations
- #

Ebase Number

CONFIRMED ACM

SYMBOL	DESCRIPTION
	Friable Asbestos-Containing Material
	Non-Friable Asbestos-Containing Material
<div>VFT</div>	Vinyl Floor Tile (Non-Friable Asbestos-Containing Material)
<div>TP</div>	Transite Pipe (Non-Friable Asbestos-Containing Material)
NOTE	Drywall Joint Compound
NOTE	Transite Board
NOTE	Mastic

For Detailed Information as to Location, Type, Quantity, Condition and Access to ACM, Please Refer to the Room-by-Room Sheets Provided in the Report.

I.E. Weldon Secondary School

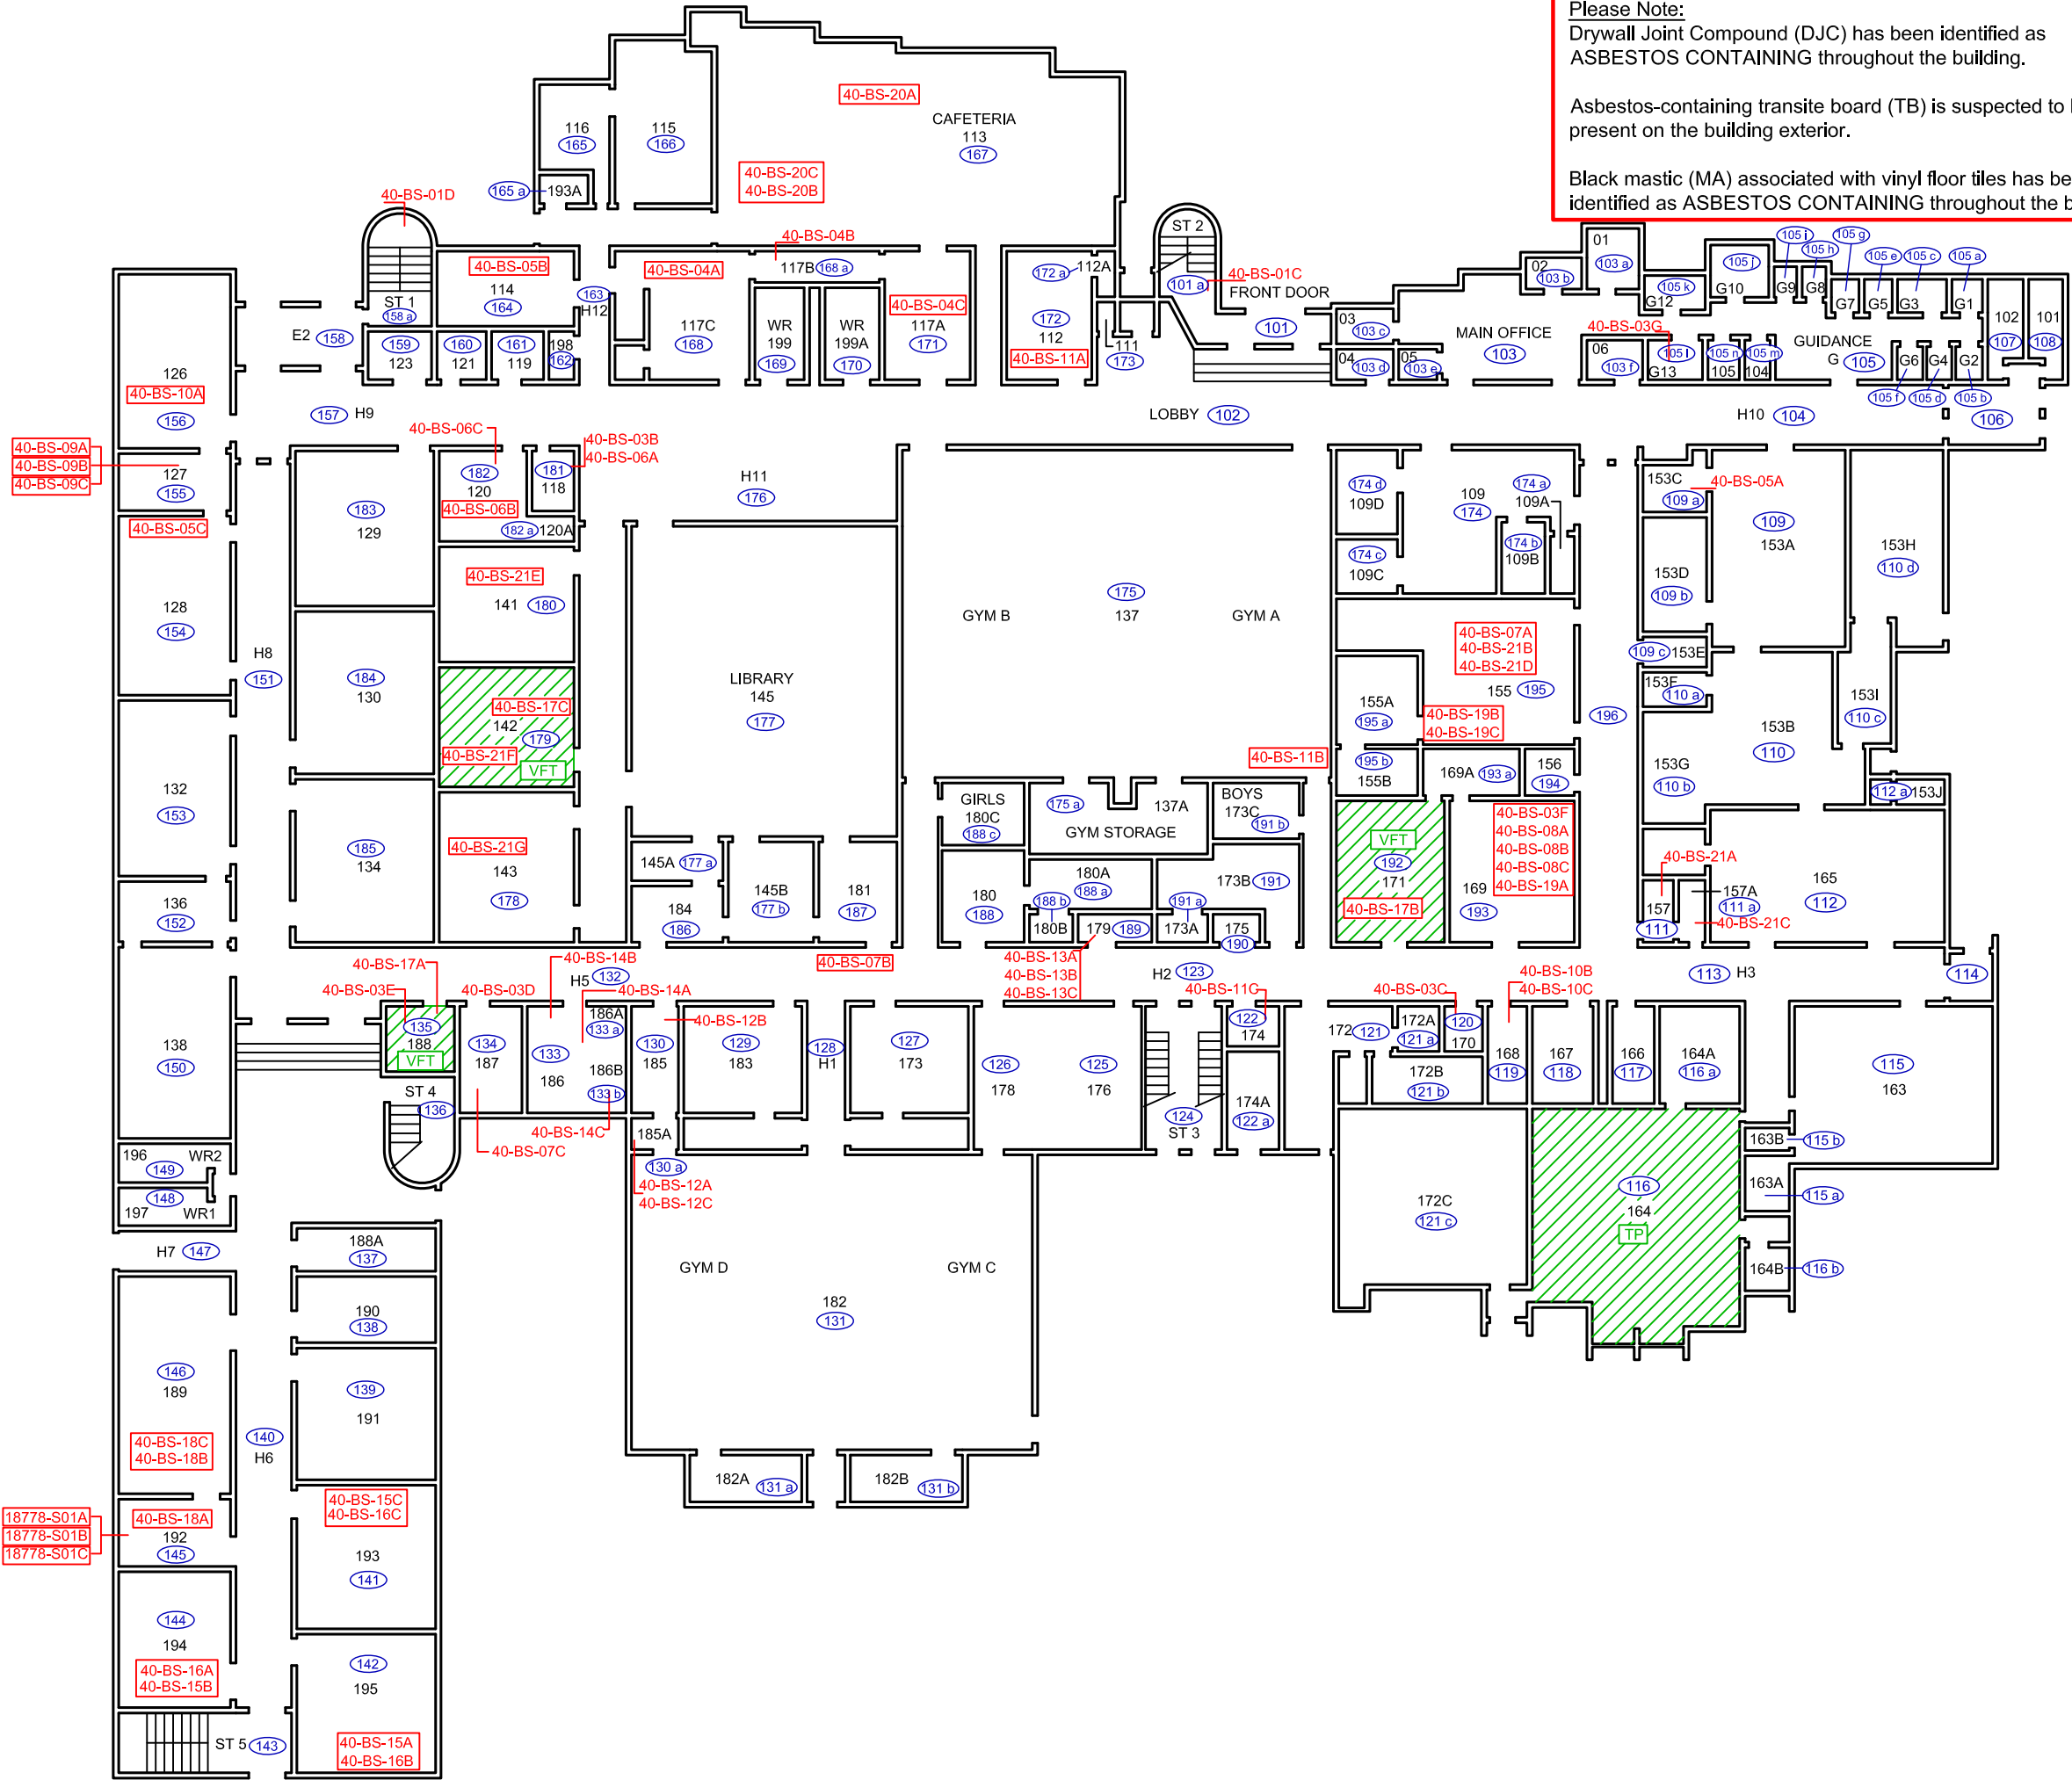
24 Weldon Road
Lindsay, Ontario

First Floor Plan

Asbestos Materials Re-Assessment Survey

CLIENT: Trillium Lakelands District School Board

PROJECT NUMBER: 18736-48	DATE: September 2020	DRW BY: S. Prosser
	SCALE: Not to Scale	CHK BY: K. Prosser





Please Note:
Drywall Joint Compound (DJC) has been identified as ASBESTOS CONTAINING throughout the building.

Asbestos-containing transite board (TB) is suspected to be present on the building exterior.

Black mastic (MA) associated with vinyl floor tiles has been identified as ASBESTOS CONTAINING throughout the building.

LEGEND

12578-48-01A

ECO H Sample Locations

01-BS-01A

Jacques Whitford Sample Locations

#

Ebase Number

CONFIRMED ACM

SYMBOL	DESCRIPTION
	Friable Asbestos-Containing Material
	Non-Friable Asbestos-Containing Material
<div>VFT</div>	Vinyl Floor Tile (Non-Friable Asbestos-Containing Material)
<div>TP</div>	Transite Pipe (Non-Friable Asbestos-Containing Material)
NOTE	Drywall Joint Compound
NOTE	Transite Board
NOTE	Mastic

For Detailed Information as to Location, Type, Quantity, Condition and Access to ACM, Please Refer to the Room-by-Room Sheets Provided in the Report.

I.E. Weldon Secondary School

24 Weldon Road
Lindsay, Ontario

Second Floor Plan

Asbestos Materials Re-Assessment Survey

CLIENT:

Trillium Lakelands District School Board

PROJECT NUMBER:

18736-48

DATE:

September 2020

DRW BY:

S. Prosser

SCALE:

Not to Scale

CHK BY:

K. Prosser

MAPLE ENVIRONMENTAL INC.

ENVIRONMENT, HEALTH & SAFETY CONSULTANTS



NOTE: DAYCARE IS NO LONGER PART OF THE FACILITY

Please Note:
Drywall Joint Compound (DJC) has been identified as ASBESTOS CONTAINING throughout the building.

Asbestos-containing transite board (TB) is suspected to be present on the building exterior.

Black mastic (MA) associated with vinyl floor tiles has been identified as ASBESTOS CONTAINING throughout the building.

LEGEND

12578-48-01A

ECOH Sample Locations

01-BS-01A

Jacques Whitford Sample Locations

#

Ebase Number

CONFIRMED ACM

SYMBOL	DESCRIPTION
	Friable Asbestos-Containing Material
	Non-Friable Asbestos-Containing Material
<div>VFT</div>	Vinyl Floor Tile (Non-Friable Asbestos-Containing Material)
<div>TP</div>	Transite Pipe (Non-Friable Asbestos-Containing Material)
NOTE	Drywall Joint Compound
NOTE	Transite Board
NOTE	Mastic

For Detailed Information as to Location, Type, Quantity, Condition and Access to ACM, Please Refer to the Room-by-Room Sheets Provided in the Report.

I.E. Weldon Secondary School

24 Weldon Road
Lindsay, Ontario

Daycare - First Floor Plan

Asbestos Materials Re-Assessment Survey

CLIENT:

Trillium Lakelands District School Board

PROJECT NUMBER:

18736-48

DATE:

September 2020

DRW BY:

S. Prosser

SCALE:

Not to Scale

CHK BY:

K. Prosser

MAPLE ENVIRONMENTAL INC.

ENVIRONMENT, HEALTH & SAFETY CONSULTANTS

APPENDIX III

POTENTIAL ASBESTOS-CONTAINING MATERIAL
IDENTIFICATION SHEET

APPENDIX III - POTENTIAL ASBESTOS-CONTAINING MATERIALS INFORMATION SHEET

<i>MIN</i>	<i>Material</i>	<i>Material Description</i>	<i>Size</i>	<i>Sample Number</i>	<i>Sample Location</i>	<i>Asbestos Containing</i>
VFT-1	Vinyl Floor Tiles	White with blue smears	12 x 12	40-BS-05 A,B,C	Room 153C,114,128	None
VFT-2	Vinyl Floor Tiles	White with black streaks	12 x 12	40-BS-06 A,B,C	Room 118,120,120A	None
VFT-3	Vinyl Floor Tiles	Black	12 x 12	40-BS-08 A,B,C	Room 156	None
VFT-4	Vinyl Floor Tiles	White with maroon streaks	12 x 12	40-BS-09 A,B,C	Room 127	0.5% Chrysotiles
VFT-5	Vinyl Floor Tiles	Green	12 x 12	40-BS-10 A,B,C	Room 126,168	None
VFT-6	Vinyl Floor Tiles	Crean with brown smears	12 x 12	40-BS-11 A,B,C	Room 112,155B,174	None
VFT-7	Vinyl Floor Tiles	Grey with white smears	12 x 12	40-BS-12 A,B,C	ROOM 185-185A	None
VFT-8	Vinyl Floor Tiles	Green with white smears	12 x 12	40-BS-13 A,B,C	Room 179	None
VFT-9	Vinyl Floor Tiles	Beige with purple smears	12 x 12	40-BS-14 A,B,C	Room 186,186A &186B	None
VFT-10	Vinyl Floor Tiles	White with grey streaks	12 x 12	40-BS-15 A,B,C	Room 195,194 &193	None
VFT-11	Vinyl Floor Tiles	Beige with maroon streaks	12 x 12	40-BS-17 A,B,C	Room 142,171 & 188	2% Chrysotiles
VFT-12	Vinyl Floor Tiles	Crean with grey streaks	12 x 12	40-BS-18 A,B,C	Room 192,189Ws & 189 Ns	None
VFT-13	Vinyl Floor Tiles	Light green with grey & white smears	9 x 9	40-BS-19 A,B,C	Room 169 & 169A	None
VFT-14	Vinyl Floor Tiles	Light greY with grey with brown streaks	9 x 9	40-BS-20 A,B,C	Cafeteria	None
CT-1	Ceiling Tiles	Medium fissure pinhole pattern	2x4	40-BS-07 A,B,C	Hallway 5, Room 155 &187	None
CT-2	Ceiling Tiles	Very small fissure pinhole pattern	2x4	40-BS-16 A,B,C	Room 193,194 &195	None
VSF-1	Vinyl Sheet Floor	Checkered	N/A	40-BS-02 A,B,C	Daycare Staffroom	None
VSF-2	Vinyl Sheet Floor	Brown with black dots	N/A	40-BS-04 A,B,C	Room 117 A,B & C	None